

General Information

Date & Time: 19, Oct, 2024 13:20

Make	Toyota	Model	Avanza
YOM	2024	Mileage	18,330
Registration No.	NHM7337	Chassis No.	MHFAA1BY5R0022684
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Red		

Body / Panel Condition



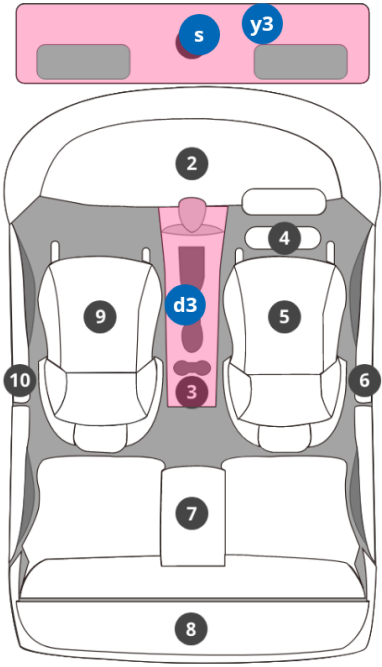
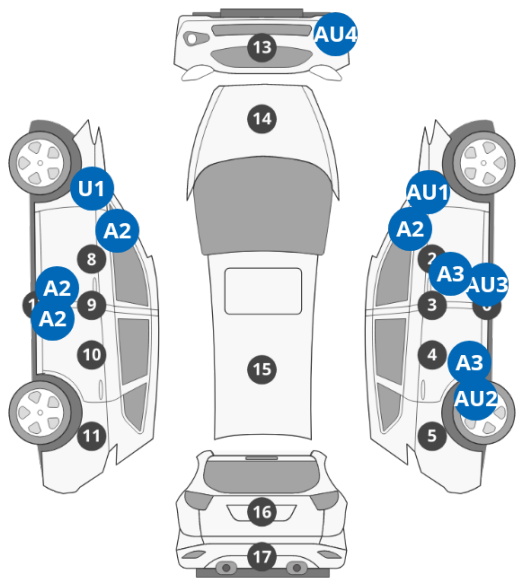
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	105	115	108
2	Boot Lid	94.5	92	102	90
3	Roof	118.0	128	126	110/108
4	Left Front Fender	101.2	104	100	100
5	Left Front Door	121.3	115	120	129
6	Center Panel Left				
7	Left Rear Door	112.6	119	108	111
8	Left Back Panel	108.6	122	105	99
9	Right Front Fender	103.0	111	101	97
10	Right Front Door	115.6	120	115	112
11	Center Panel Right				
12	Right Rear Door	112.6	111	106	121
13	Right Back Panel	110.3	101	106	124

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Console, Switchs, Vents - Loose, Deformed, Grime - Medium / Overall Interior - Smell - Yes / Ceiling - Grime - Medium	Remarks (L) Front Fender, Molding - Dent - Minimal / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

more scratch and dents at the exterior. swirl marks and hairline scratches around the exterior. mattings has dirty marks.