

General Information

Date & Time: 31, May, 2025 15:05

Make	Toyota	Model	Rush
YOM	2021	Odo Meter Reading	77,002
Registration No.	DAT6565	Chassis No.	MHKE8FF3PLK027697
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Red		

Body / Panel Condition



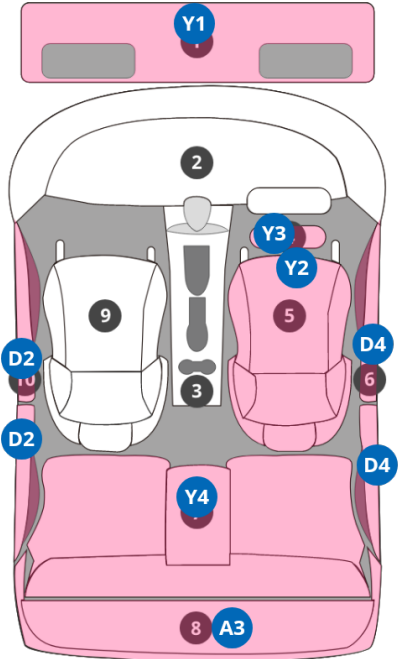
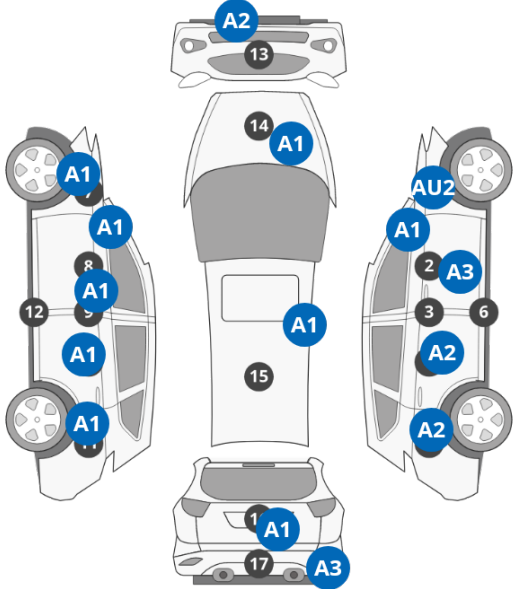
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.3	111	111	109
2	Boot Lid	110.5	100	121	111
3	Roof	103.9	91	98	114/113
4	Left Front Fender	109.0	109	117	101
5	Left Front Door	114.3	116	114	113
6	Center Panel Left				
7	Left Rear Door	110.3	123	106	102
8	Left Back Panel	106.7	113	96	111
9	Right Front Fender	106.6	102	107	111
10	Right Front Door	105.3	103	106	107
11	Center Panel Right				
12	Right Rear Door	104.9	89	117	109
13	Right Back Panel	112.0	118	113	105

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / Mat Other - Grime - Medium / (R) Rear Trim - Worked - Large / (R) Front Seat - Grime - Small / (R) Front Trim - Worked - Large / Trunk Room - Worn, Scratch, Cut, Crack - Medium / (L) Rear Trim - Worked - Small / (L) Front Trim - Worked - Small / Ceiling - Grime - Minimal</p>	<p>Remarks (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / Roof - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with warranty booklet, no jack, no tools, with spare tire</p>