

General Information

Date & Time: 31, May, 2025 15:46

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	89,603
Registration No.	NFL2652	Chassis No.	PA1B18F36N4176299
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



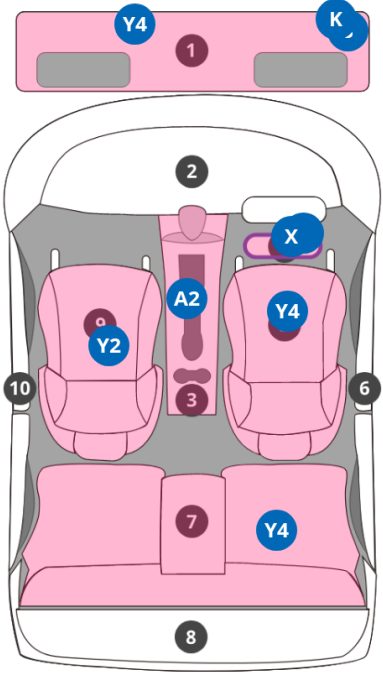
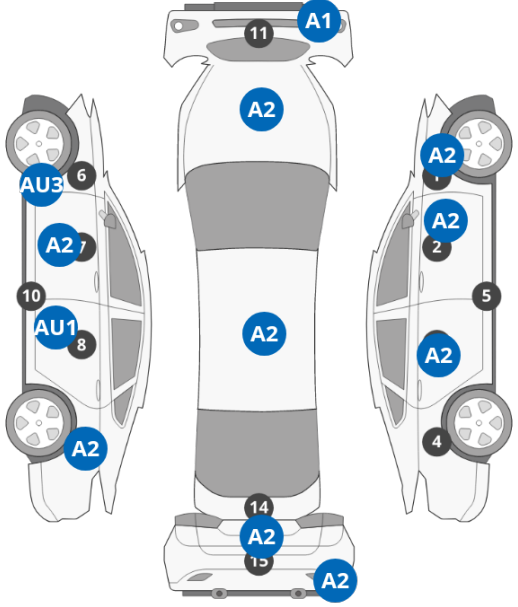
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.3	106	107	112
2	Boot Lid	108.6	101	113	112
3	Roof	97.2	104	95	89/101
4	Left Front Fender	98.2	94	100	101
5	Left Front Door	107.3	107	108	107
6	Center Panel Left				
7	Left Rear Door	107.3	110	106	106
8	Left Back Panel	110.0	116	111	103
9	Right Front Fender	91.6	97	88	90
10	Right Front Door	97.5	104	96	93
11	Center Panel Right				
12	Right Rear Door	101.6	96	102	107
13	Right Back Panel	105.5	103	98	116

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / Overall Interior - Animal Hair - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Seat - Grime - Large / Rear Seat - Grime - Large / Ceiling - Grime - Large / (L) Front Seat - Grime - Small / Knobs - Worn, Peel, Crack - Small</p>	<p>Remarks (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Minimal / Roof - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate and Jack, Spare tire and incomplete tools. no warranty booklet. scratches on tail lights and head lights, adhesive marks on front windshield and back glass and trunk. small bubbles on roof.</p>