

General Information

Date & Time: 19, Oct, 2024 14:33

Make	Toyota	Model	Vios
YOM	2024	Mileage	9,408
Registration No.	EAJ1683	Chassis No.	PA1B18F37P4231197
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



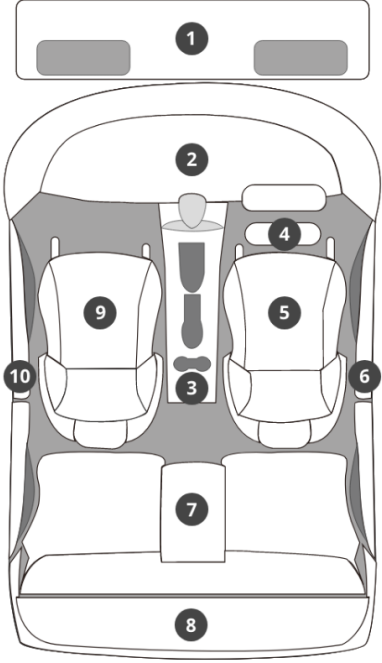
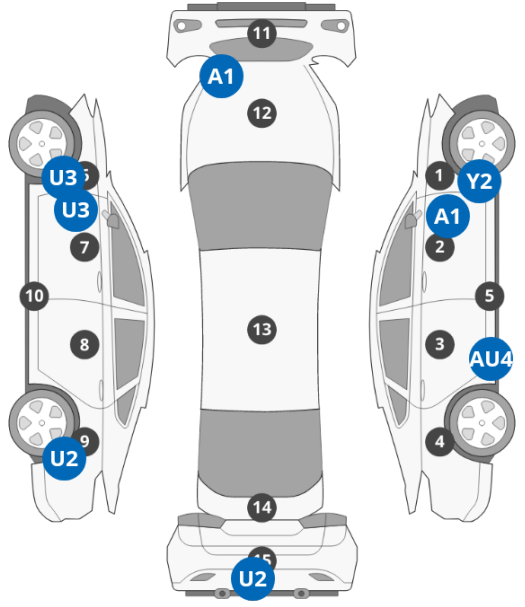
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	126.6	123	131	126
2	Boot Lid	110.0	107	105	118
3	Roof	123.0	127	122	121/122
4	Left Front Fender	106.3	106	101	112
5	Left Front Door	114.3	114	111	118
6	Center Panel Left				
7	Left Rear Door	117.6	123	122	108
8	Left Back Panel	124.6	131	124	119
9	Right Front Fender	117.0	122	103	126
10	Right Front Door	128.6	159	110	117
11	Center Panel Right				
12	Right Rear Door	130.0	121	121	148
13	Right Back Panel	119.3	115	115	128

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Defects not found	Remarks (L) Front Fender, Molding - Dent - Medium / (L) Front Door, Molding - Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Dent - Small / (L) Rear Fender, Molding - Dent - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Crack, Gap - Small / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
no reverse camera