

General Information

Date & Time: 19, Oct, 2024 09:28

Make	Toyota	Model	Wigo
YOM	2024	Mileage	4,738
Registration No.	EAG6532	Chassis No.	MHKAA1BC3PJ004536
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Silver		

Body / Panel Condition



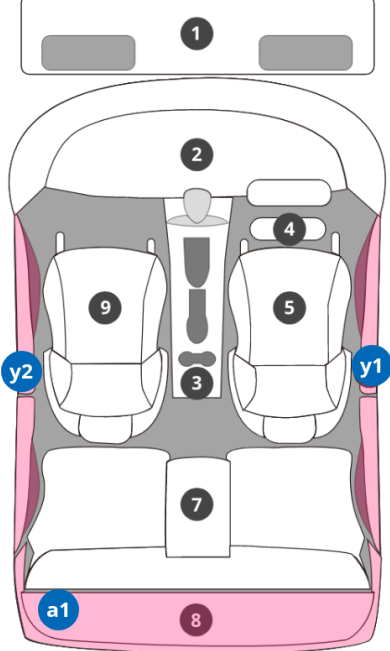
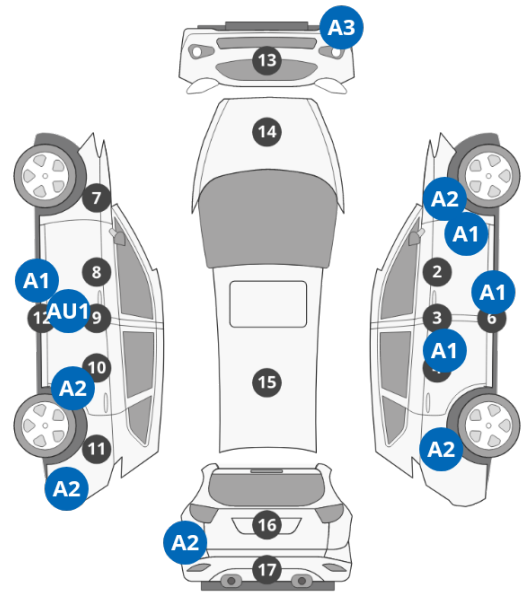
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	126.3	135	122	122
2	Boot Lid	98.3	94	103	98
3	Roof	97.3	89	96	116/88
4	Left Front Fender	91.6	82	97	95
5	Left Front Door	108.0	99	106	119
6	Center Panel Left				
7	Left Rear Door	102.5	110	102	96
8	Left Back Panel	98.5	99	93	104
9	Right Front Fender	99.3	105	98	95
10	Right Front Door	102.7	113	100	95
11	Center Panel Right				
12	Right Rear Door	102.6	94	98	116
13	Right Back Panel	95.8	100	92	96

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Minimal	Remarks Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
no retractable mirror featured in this unit. , more light scratches around the exterior. adhesive marks at both side mirrors.