


## General Information

Date & Time: 03, Jun, 2025 17:44

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	45,892
<b>Registration No.</b>	DBF4451	<b>Chassis No.</b>	PA1B18F32M4159921
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition

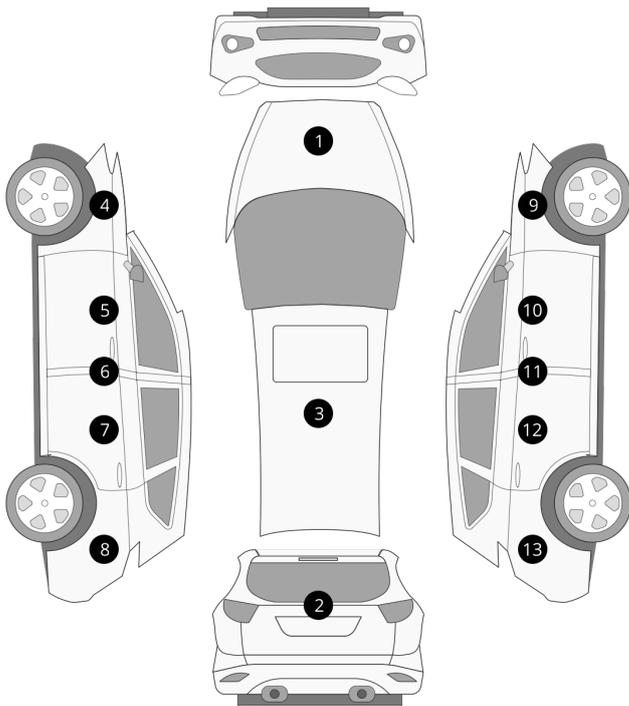

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	182.6	183	190	175
2	Boot Lid	201.3	213	218	173
3	Roof	103.8	105	101	98/111
4	Left Front Fender	195.3	193	229	164
5	Left Front Door	96.0	89	100	100
6	Center Panel Left				
7	Left Rear Door	97.7	97	104	92
8	Left Back Panel	107.6	109	107	107
9	Right Front Fender	224.3	184	242	247
10	Right Front Door	227.0	293	215	173
11	Center Panel Right				
12	Right Rear Door	227.0	225	163	293
13	Right Back Panel	196.6	229	182	179

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b>	<b>B</b>	<b>Exterior Evaluation :</b>	<b>E</b>
<p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>		<p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>	
<p><b>Remarks</b> Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Small / Console, Switches, Vents - Traces of Adhesive Tape - Yes</p>		<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch &amp; Dent - Large / (R) Front Door, Molding - Scratch &amp; Dent - Large / (R) Rear Door, Molding - Scratch &amp; Dent - Large / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Fender, Molding - Dent - Small / (L) Rear Fender, Molding - Modified - Small / (L) Front Fender, Molding - Modified - Small / (R) Front Fender, Molding - Modified - Small / (R) Rear Fender, Molding - Modified - Small / (L) Step, In-panel, Side Spoiler - Modified - Large / (L) Step, In-panel, Side Spoiler - Scratch - Large / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Modified - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / (R) Step, In-panel, Side Spoiler - Rust, Corrosion - Small / Roof - Dent - Minimal</p>	
<b>Frame Evaluation :</b>	<b>C</b>	<b>Functional Evaluation :</b>	<b>C</b>
<p><b>Remarks</b> Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>		<p><b>Remarks</b> Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>	

<b>Inspector Notes</b>
no warranty booklet, with jack, incomplete tools, with spare mags, with LTO plate, weak battery, power steering issue due to weak battery, dome and plate light issue, horn issue, no reverse camera