

General Information

Date & Time: 23, Oct, 2024 15:42

Make	Ford	Model	Fiesta
YOM	2011	Mileage	140,436
Registration No.	PQM987	Chassis No.	MNBJXXARJJBC34763
CC	1.6	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Blue		

Body / Panel Condition



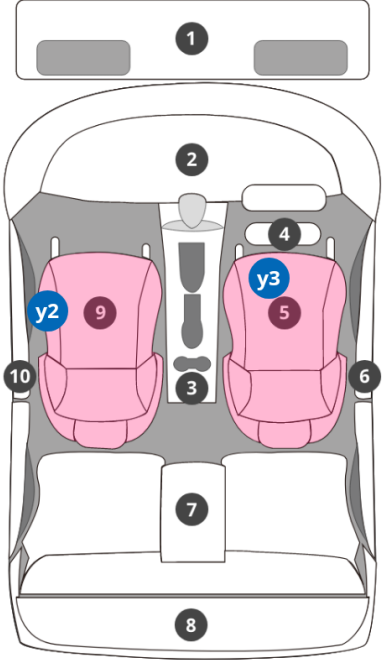
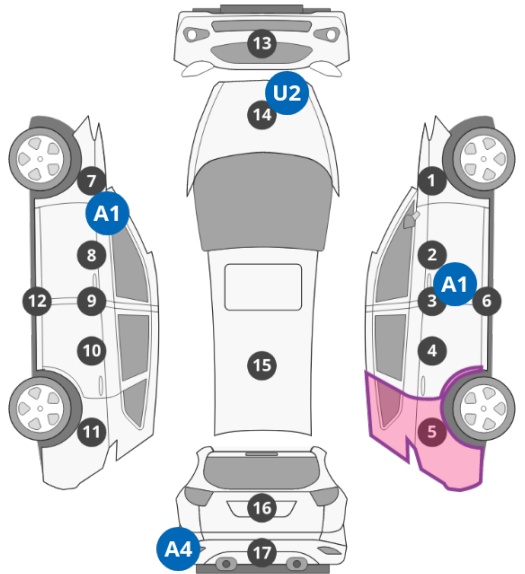
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.3	122	120	116
2	Boot Lid	89.7	83	96	90
3	Roof	119.5	112	114	128/124
4	Left Front Fender	107.0	111	110	100
5	Left Front Door	114.6	117	115	112
6	Center Panel Left				
7	Left Rear Door	110.6	113	112	107
8	Left Back Panel	117.6	119	117	117
9	Right Front Fender	109.6	102	111	116
10	Right Front Door	172.0	180	155	181
11	Center Panel Right				
12	Right Rear Door	166.0	156	162	180
13	Right Back Panel	254.0	289	276	197

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Medium / (L) Front Seat Knobs - Stuck - Yes / Overall Interior - Worn as per age - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Bonnet, Headlight - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Overall Exterior - Faded(Color, Gloss) - Yes / (L) Mirror - Scratch, Peeled - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Repair mark - Difference in Color
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Steering - Issue - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Head Light, High Beam - Issue - Yes

Inspector Notes
driver, front passenger repaired/ volume knob has issues/ driver seat knob is not functioning/