

General Information

Date & Time: 04, Jun, 2025 08:41

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	26,694
Registration No.	DBB5967-1	Chassis No.	PA1B18F35P4205746
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



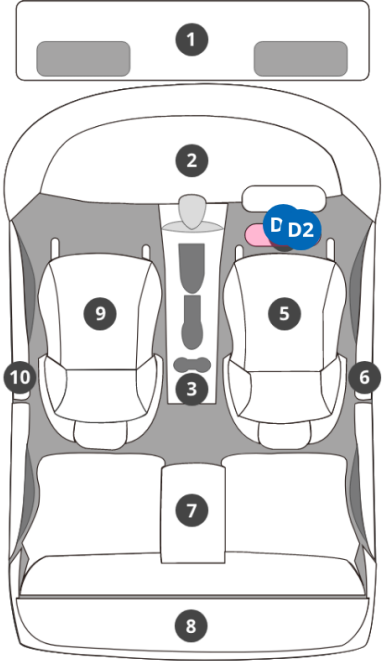
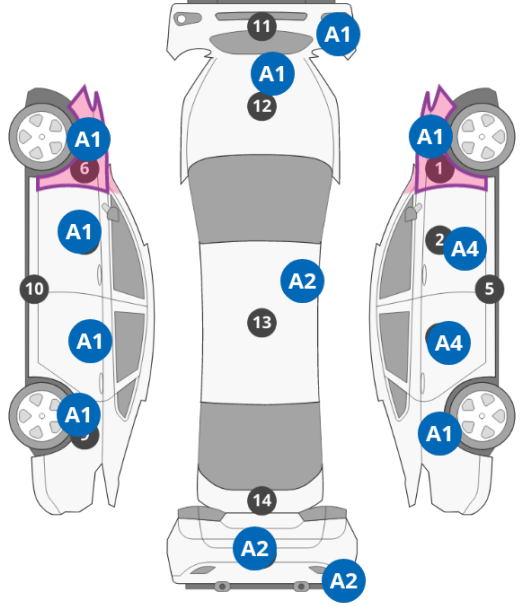
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.3	105	101	104
2	Boot Lid	110.6	106	113	113
3	Roof	123.2	105	140	147/101
4	Left Front Fender	231.3	312	226	156
5	Left Front Door	99.9	100	93	107
6	Center Panel Left				
7	Left Rear Door	104.2	113	105	95
8	Left Back Panel	102.3	102	102	103
9	Right Front Fender	181.0	121	169	253
10	Right Front Door	92.1	96	88	92
11	Center Panel Right				
12	Right Rear Door	100.7	95	97	111
13	Right Back Panel	107.1	100	106	116

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / (L) Front Floor Mat - Worked - Small / Mat Other - Crinkle - Small</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate and Jack, Spare tire and incomplete tools. no warranty booklet, scratch headlight and tail light. and sticker/adhesive marks on right rear window and left rear bumper.</p>