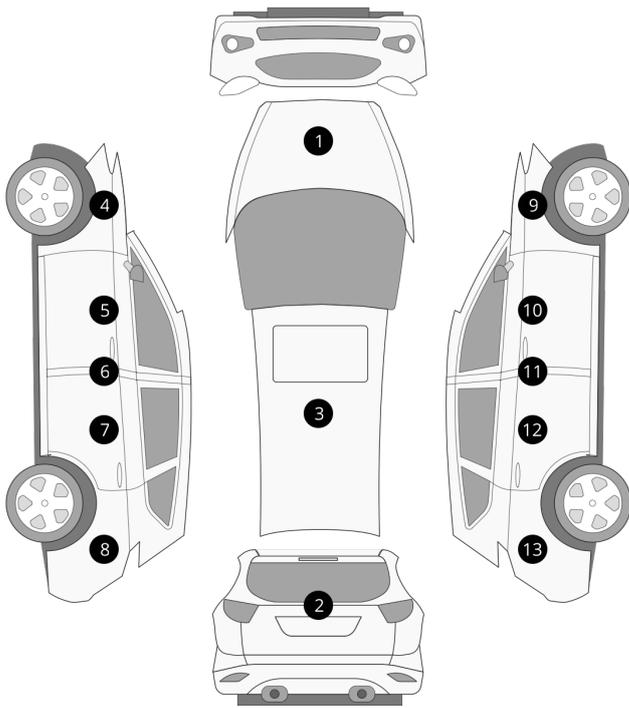


General Information

Date & Time: 19, Jun, 2025 10:34

Make	Toyota	Model	Hiace
YOM	2022	Odo Meter Reading	64,282
Registration No.	NIE2607	Chassis No.	JTFJT02P5N5031672
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



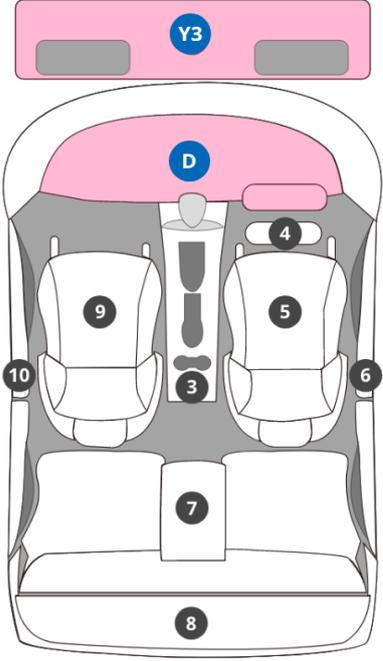
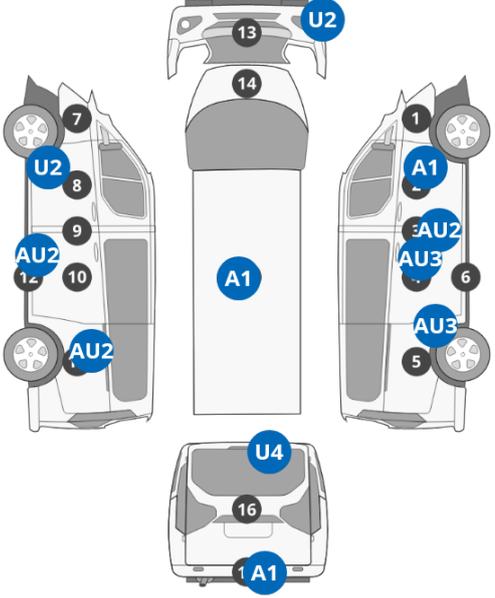
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	91.0	94	100	80
2	Boot Lid	90.3	88	95	88
3	Roof	98.3	92	99	96/106
4	Left Front Fender	103.3	90	107	113
5	Left Front Door	89.8	90	88	92
6	Center Panel Left	95.1	98	102	86
7	Left Rear Door	92.5	96	91	91
8	Left Back Panel	91.3	82	86	107
9	Right Front Fender	88.1	88	88	89
10	Right Front Door	82.8	86	80	83
11	Center Panel Right	93.1	109	92	79
12	Right Rear Door	92.2	90	98	88
13	Right Back Panel	100.5	114	97	91

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks (R) Front Door, Molding - Scratch - Minimal / (R) Center Panel - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Dent - Small / Front Bumper, Grille, Lamps - Dent - Small / Roof - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with warranty booklet, with jack, no tools, with spare tire</p>