


General Information

Date & Time: 20, Jun, 2025 08:08

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	27,007
Registration No.	DBG5250	Chassis No.	PA1B18F38R4200492
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition

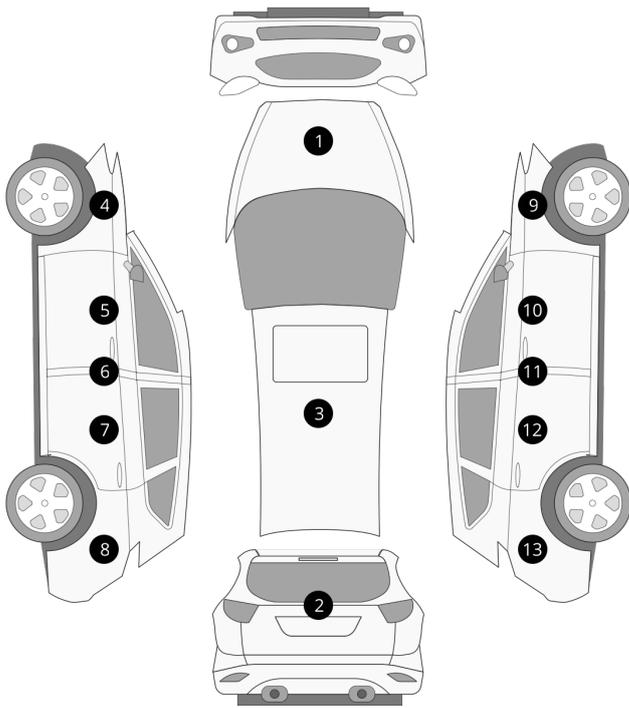


#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.6	107	108	102
2	Boot Lid	96.6	96	92	102
3	Roof	91.0	93	92	88/91
4	Left Front Fender	90.8	84	92	96
5	Left Front Door	98.9	100	100	97
6	Center Panel Left				
7	Left Rear Door	97.1	104	97	91
8	Left Back Panel	102.1	108	99	100
9	Right Front Fender	92.1	94	92	90
10	Right Front Door	96.1	106	89	93
11	Center Panel Right				
12	Right Rear Door	94.6	88	92	103
13	Right Back Panel	93.5	92	94	95

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

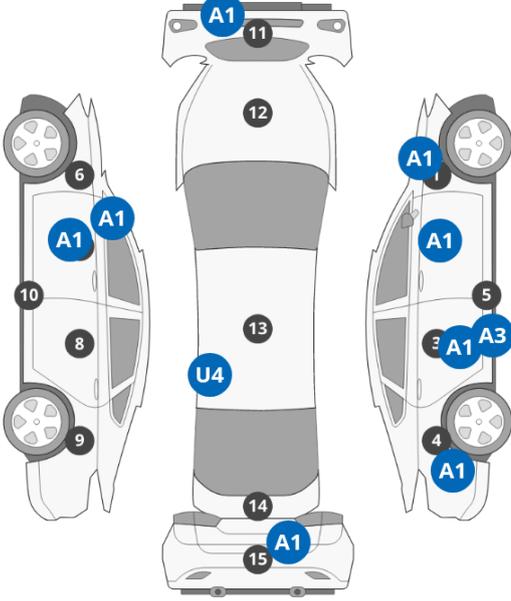Interior Evaluation :	C	Exterior Evaluation :	C
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Large / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Medium / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Ceiling - Grime - Minimal</p>		<p>Remarks (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / Roof - Dent - Large</p>	
Frame Evaluation :	A	Functional Evaluation :	B
<p>Remarks Defects not found</p>		<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Wiper - Function - Weak</p>	

Inspector Notes
with LTO plate/with spare tire/with jack and tools/No reverse camera/No warranty booklet/wiper issue