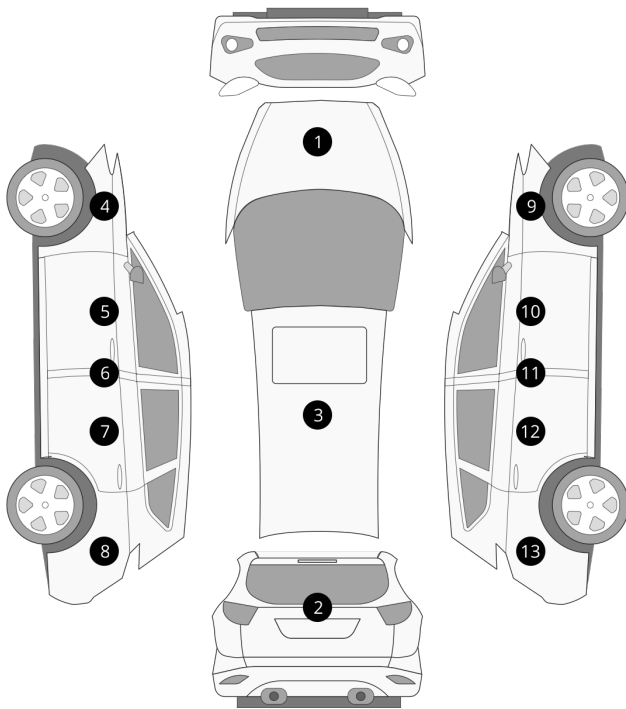


General Information

Date & Time: 01, Jul, 2025 18:28

Make	Toyota	Model	Raize
YOM	2024	Odo Meter Reading	33,335
Registration No.	NHQ8316	Chassis No.	MHKAA1BA5PJ109027
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	Black		

Body / Panel Condition



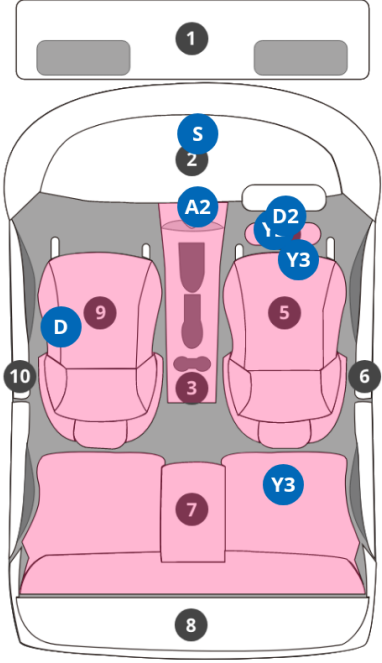
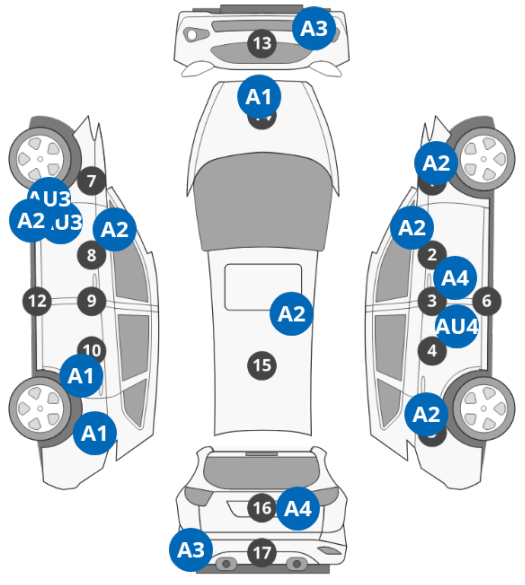
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	145.0	137	151	147
2	Boot Lid	121.6	124	130	111
3	Roof	112.2	110	118	113/108
4	Left Front Fender	124.3	123	139	111
5	Left Front Door	129.3	117	138	133
6	Center Panel Left				
7	Left Rear Door	131.0	125	126	142
8	Left Back Panel	107.3	112	100	110
9	Right Front Fender	132.6	123	146	129
10	Right Front Door	123.3	125	128	117
11	Center Panel Right				
12	Right Rear Door	124.6	123	121	130
13	Right Back Panel	111.0	112	118	103

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Worn - Yes / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Overall Interior - Smell - Yes	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Large / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, no jack, with tools, with spare tire, with LTO plate, weak battery, plate light issue.