

General Information

Date & Time: 07, Jun, 2025 13:53

Make	Toyota	Model	Wigo
YOM	2021	Odo Meter Reading	50,168
Registration No.	GAT8869	Chassis No.	MHKA4DF5FMJ055094
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Orange		

Body / Panel Condition



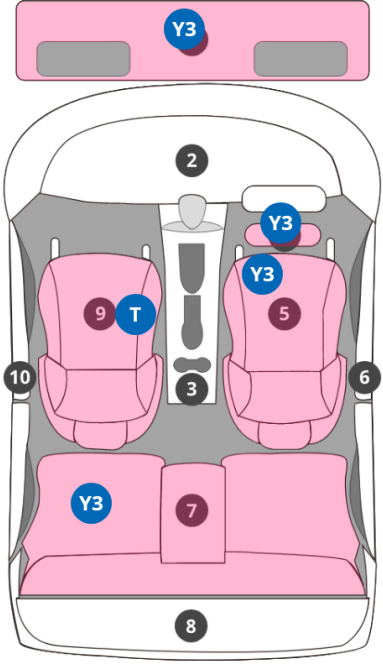
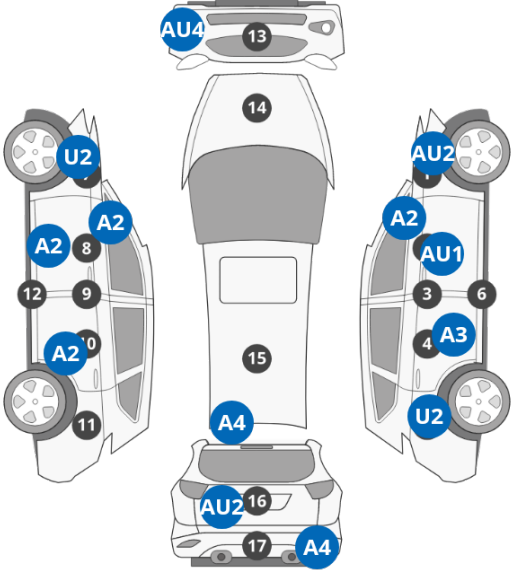
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	154.0	158	163	141
2	Boot Lid	158.6	156	155	165
3	Roof	145.2	160	140	143/138
4	Left Front Fender	128.0	138	128	118
5	Left Front Door	131.0	130	132	131
6	Center Panel Left				
7	Left Rear Door	154.0	169	150	143
8	Left Back Panel	220.6	206	242	214
9	Right Front Fender	176.0	281	130	117
10	Right Front Door	132.3	136	139	122
11	Center Panel Right				
12	Right Rear Door	128.6	141	126	119
13	Right Back Panel	130.6	128	135	129

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / (R) Front Seat - Grime - Medium / Mat Other - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Seat - Cigarette Burns - Burnt</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Overall Exterior - Faded(Color, Gloss) - Yes / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Dent - Small / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Rear Fender, Molding - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Roof Spoiler, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Air Conditioner - Function - Weak / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Faded car paint. trunk floor missing. with warranty booklet, spare tire and jack. Incomplete tools. 1 key, with LTO plate. rear view mirror issue.</p>