

General Information

Date & Time: 07, Jun, 2025 15:38

Make	Nissan	Model	NV350
YOM	2021	Odo Meter Reading	43,400
Registration No.	NEP6581	Chassis No.	JN1TC2E26Z0065291
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



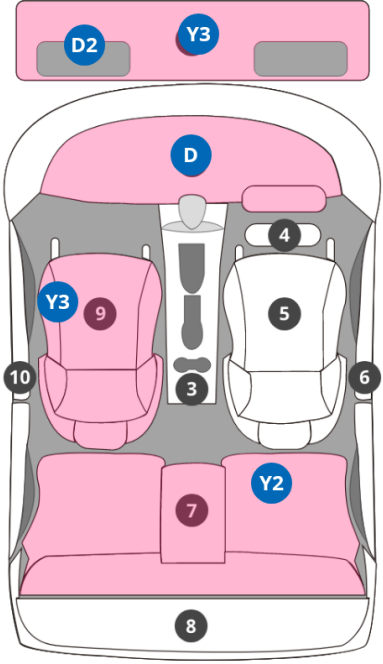
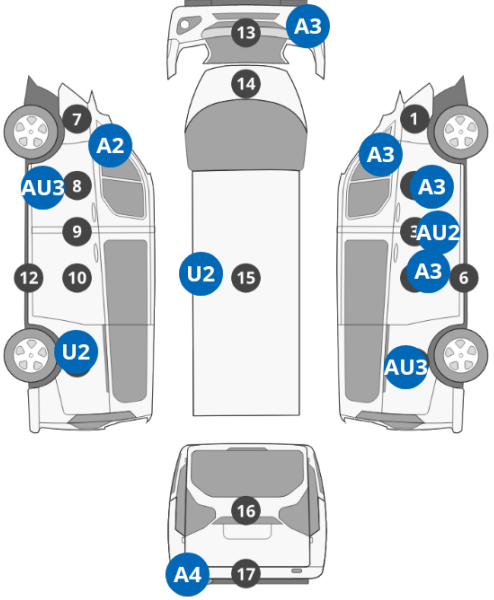
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	94.6	97	91	96
2	Boot Lid	82.6	80	87	81
3	Roof	86.6	95	88	82/83
4	Left Front Fender	94.8	94	96	95
5	Left Front Door	94.0	104	90	89
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	100.6	106	98	98
9	Right Front Fender	99.5	98	100	101
10	Right Front Door	105.0	103	100	112
11	Center Panel Right				
12	Right Rear Door	102.3	97	105	105
13	Right Back Panel	104.6	103	103	108

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / Sunvisor, Sunglass Holder - Crinkle - Small / Rear Seat - Grime - Small / (L) Front Seat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks (L) Front Door, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Dent - Small / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Mirror - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Center Panel - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / Roof - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Without warranty booklet and tools. with spare tire and jack. 1 key. with LTO plate</p>