

General Information

Date & Time: 07, Jun, 2025 16:35

Make	Mitsubishi	Model	Xpander
YOM	2019	Odo Meter Reading	28,500
Registration No.	CAU1067	Chassis No.	MK2XRNC1WKN073986
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



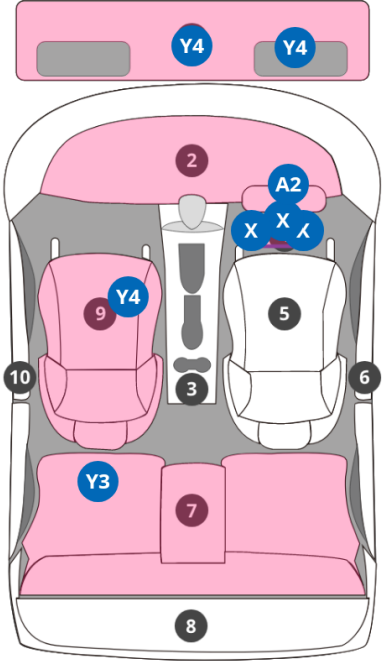
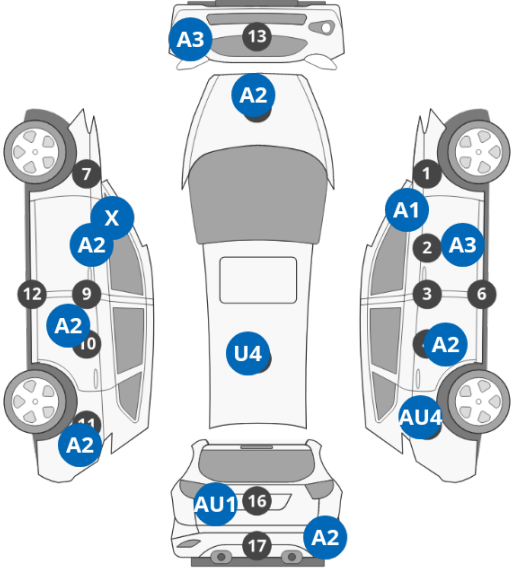
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	139.3	130	133	155
2	Boot Lid	117.6	116	122	115
3	Roof	112.5	131	125	93/101
4	Left Front Fender	125.3	127	133	116
5	Left Front Door	138.6	128	147	141
6	Center Panel Left				
7	Left Rear Door	146.3	152	152	135
8	Left Back Panel	143.6	150	146	135
9	Right Front Fender	121.0	116	112	135
10	Right Front Door	134.0	141	136	125
11	Center Panel Right				
12	Right Rear Door	130.6	125	130	137
13	Right Back Panel	139.3	127	143	148

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Sunvisor, Sunglass Holder - Grime - Large / Ceiling - Grime - Large / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Large / Steering Wheel - Worn, Peel, Crack - Small</p>	<p>Remarks Bonnet, Headlight - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Mirror - Scratch - Minimal / Roof - Dent - Large / (L) Mirror - Stuck - Yes</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Retractable Mirror - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>reverse light issue. powerfolding side mirror issue. left side mirror loose. without warranty booklet,jack and tools. with spare tire. 1 key. with LTO plate.</p>