

## General Information

Date & Time: 09, Jun, 2025 10:29

<b>Make</b>	Toyota	<b>Model</b>	Fortuner
<b>YOM</b>	2017	<b>Odo Meter Reading</b>	135,525
<b>Registration No.</b>	DAB4338	<b>Chassis No.</b>	MHFJB8GS55G1521390
<b>CC</b>	2.4	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	SUV
<b>Colour</b>	Brown		

## Body / Panel Condition



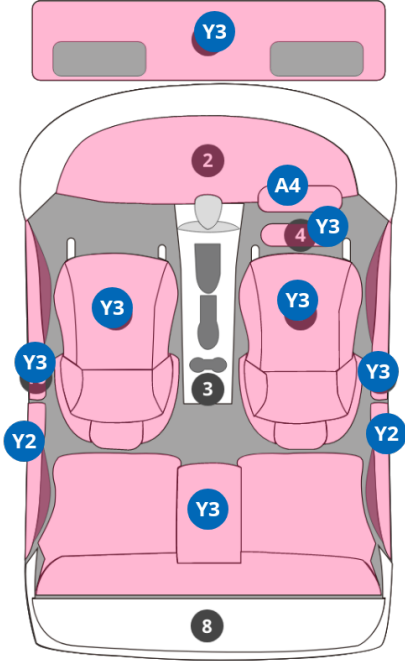
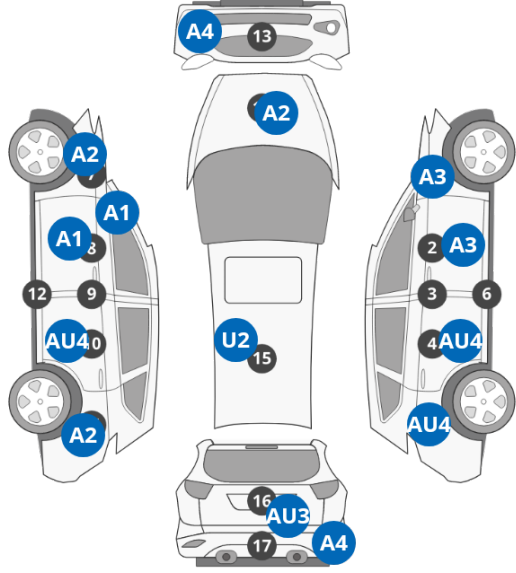
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	111	124	103
2	Boot Lid	119.0	109	138	110
3	Roof	115.1	133	126	104/97
4	Left Front Fender	108.6	105	111	110
5	Left Front Door	113.6	123	113	105
6	Center Panel Left				
7	Left Rear Door	103.2	111	100	99
8	Left Back Panel	113.6	129	106	106
9	Right Front Fender	113.0	112	114	113
10	Right Front Door	113.0	115	111	113
11	Center Panel Right				
12	Right Rear Door	106.2	104	100	115
13	Right Back Panel	119.3	120	109	129

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>E</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b>          Ceiling - Grime - Medium / (R) Front Trim - Grime - Medium / (R) Front Floor Mat - Grime - Medium / (R) Front Seat - Grime - Medium / (R) Rear Trim - Grime - Small / Rear Seat - Grime - Medium / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Large</p>	<p><b>Remarks</b>          (L) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch &amp; Dent - Large / (R) Front Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch &amp; Dent - Large / Trunk Hood, Rear Gate - Scratch &amp; Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch &amp; Dent - Large / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / Roof - Dent - Small / (R) Front Fender, Molding - Scratch - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>C</b></span>
<p><b>Remarks</b>          Defects not found</p>	<p><b>Remarks</b>          Warning Lamps - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Without warranty booklet and seat cover. with spare tire, jack and tools. 1 key. with LTO plate. low battery. fuel filter warning lamp.</p>