

General Information

Date & Time: 09, Jun, 2025 12:33

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	93,844
Registration No.	DAT6843	Chassis No.	PA1B118F36L4128900
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



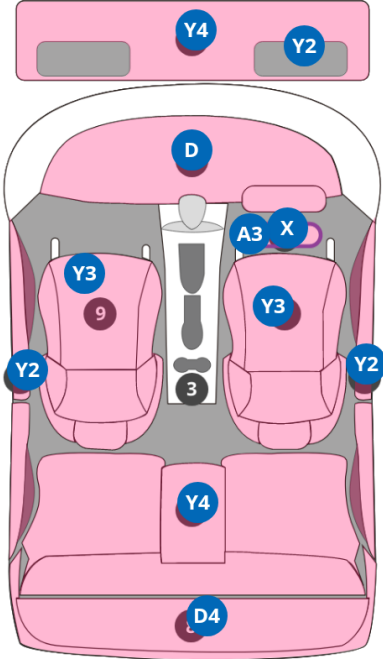
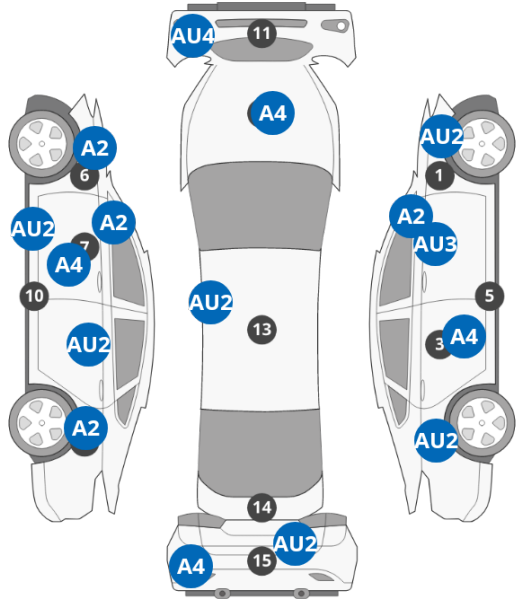
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	105	109	114
2	Boot Lid	98.9	102	97	98
3	Roof	90.9	99	89	87/89
4	Left Front Fender	93.6	90	97	94
5	Left Front Door	98.7	103	101	92
6	Center Panel Left				
7	Left Rear Door	93.5	98	92	90
8	Left Back Panel	108.3	119	101	105
9	Right Front Fender	97.1	98	100	94
10	Right Front Door	96.1	100	96	92
11	Center Panel Right				
12	Right Rear Door	93.5	92	89	99
13	Right Back Panel	96.2	95	91	103

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Large / Sunvisor, Sunglass Holder - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large / Mat Other - Missing - Yes / Trunk Room - Loose, Deformed - Large / (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Seat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Small</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Large / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / Roof - Scratch & Dent - Small / (L) Mirror - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Large / (L) Front Fender, Molding - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Left parklight issue. possible flooding. original mattings missing. trunk floor missing. Without warranty booklet, spare tire, seat cover, jack and tools. 1 key. with LTO plate.</p>