

General Information

Date & Time: 28, Oct, 2024 13:46

Make	Toyota	Model	Vios
YOM	2024	Mileage	4,263
Registration No.	NFR8692	Chassis No.	PA1B18F3XR4257215
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



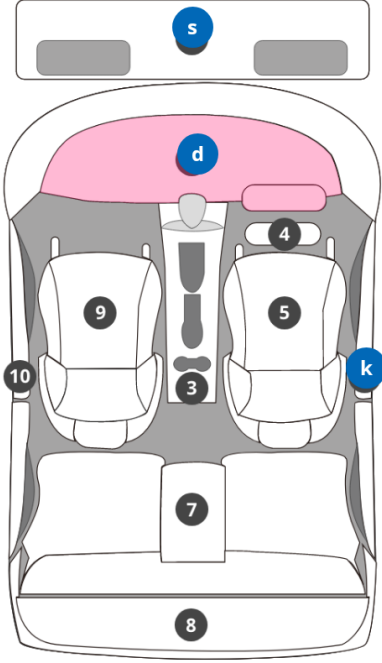
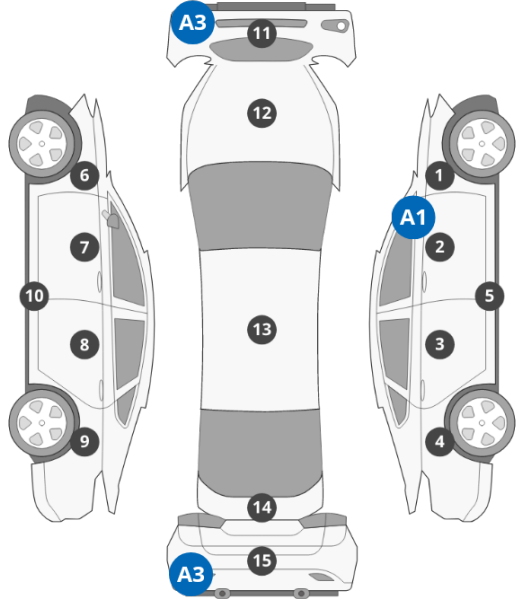
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.1	111	99	112
2	Boot Lid	103.3	102	103	105
3	Roof	103.2	102	102	100/109
4	Left Front Fender	99.1	100	101	97
5	Left Front Door	97.1	96	98	98
6	Center Panel Left				
7	Left Rear Door	101.5	102	106	97
8	Left Back Panel	106.6	109	106	105
9	Right Front Fender	103.3	104	106	100
10	Right Front Door	103.0	101	105	103
11	Center Panel Right				
12	Right Rear Door	106.0	98	106	114
13	Right Back Panel	110.0	104	106	120

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / Dashboard - Traces of Adhesive Tape - Yes / Overall Interior - Animal Hair - Yes	Remarks Front Bumper, Grille, Lamps - Scratch - Medium / (R) Mirror - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

more light scratches around the exterior. Gap at the left rear bumper. trace of adhesive mark at the roof