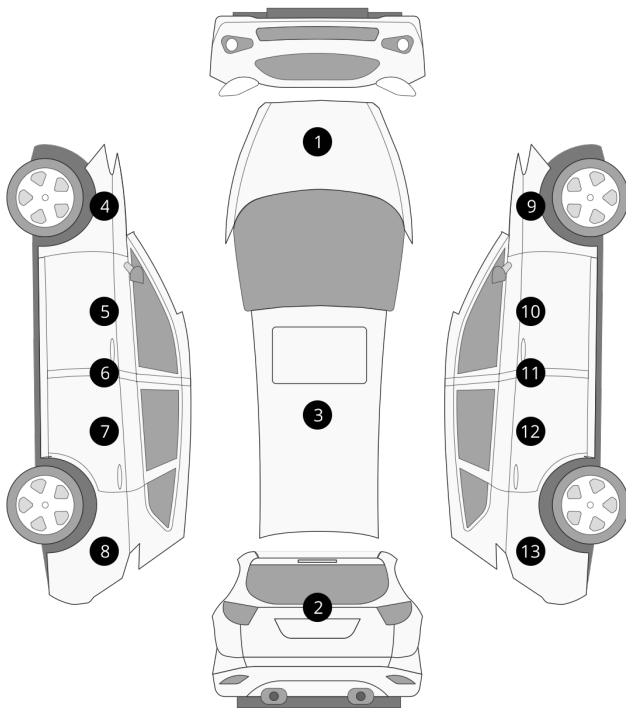


General Information

Date & Time: 29, Oct, 2024 08:35

Make	Toyota	Model	Vios
YOM	2024	Mileage	7,538
Registration No.	NKB5834	Chassis No.	PA1B18F32R4248878
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



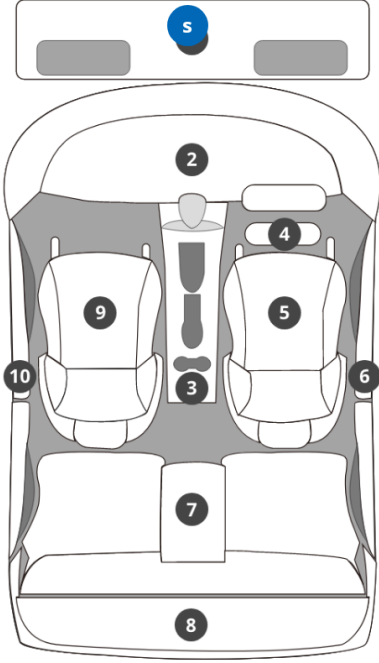
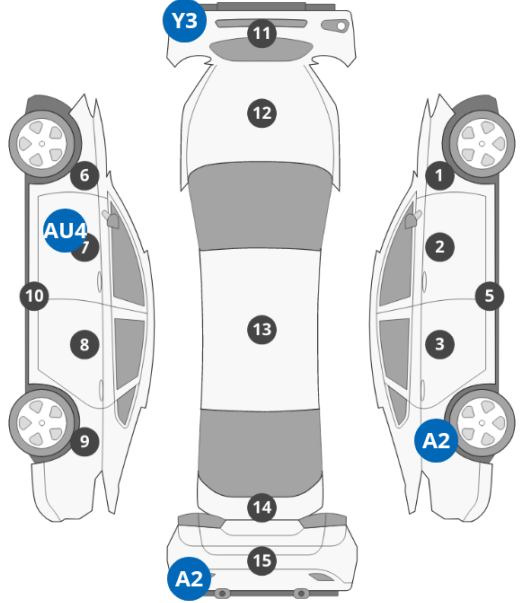
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.6	120	111	113
2	Boot Lid	106.3	100	107	112
3	Roof	100.8	102	101	99/102
4	Left Front Fender	98.3	97	103	95
5	Left Front Door	100.4	101	102	98
6	Center Panel Left				
7	Left Rear Door	102.3	100	104	103
8	Left Back Panel	109.6	115	110	104
9	Right Front Fender	111.6	108	114	113
10	Right Front Door	108.3	107	106	112
11	Center Panel Right				
12	Right Rear Door	111.3	112	112	110
13	Right Back Panel	112.6	108	114	116

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes	Remarks Front Bumper, Grille, Lamps - Crack, Gap - Medium / (L) Front Door, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

more light scratches around the exterior. dirty floor mats.