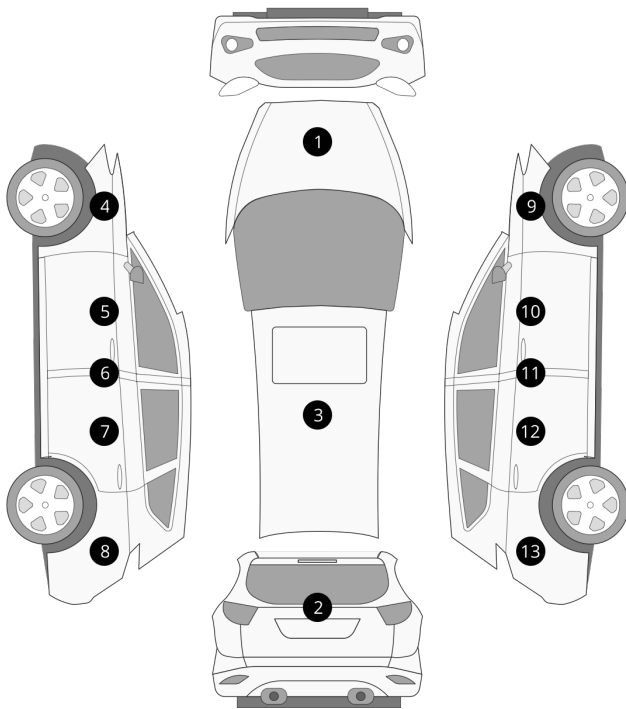


General Information

Date & Time: 13, Jun, 2025 16:54

Make	Honda	Model	BR-V
YOM	2020	Odo Meter Reading	31,306
Registration No.	NFW5097	Chassis No.	PADDG1810LV301257
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Gray		

Body / Panel Condition



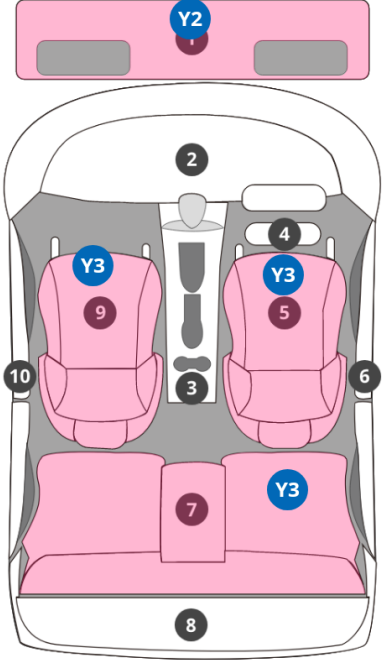
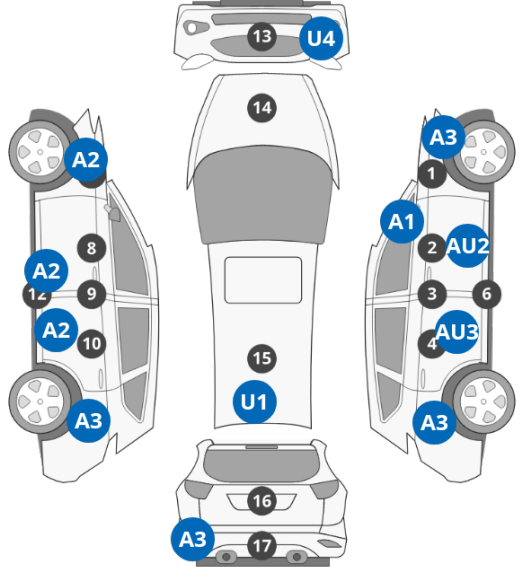
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.0	110	122	110
2	Boot Lid	70.6	61	53	98
3	Roof	74.9	58	79	74/88
4	Left Front Fender	65.6	70	64	63
5	Left Front Door	64.5	60	59	75
6	Center Panel Left				
7	Left Rear Door	221.6	214	220	231
8	Left Back Panel	117.5	92	101	160
9	Right Front Fender	77.6	75	81	77
10	Right Front Door	75.4	77	69	80
11	Center Panel Right				
12	Right Rear Door	105.6	132	83	102
13	Right Back Panel	86.4	77	85	97

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / Ceiling - Grime - Small / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Medium	Remarks (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Dent - Large / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / Roof - Dent - Minimal / (R) Front Fender, Molding - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
Without warranty booklet and seat cover. with jack, tools and spare tire. 1 key. with LTO plate