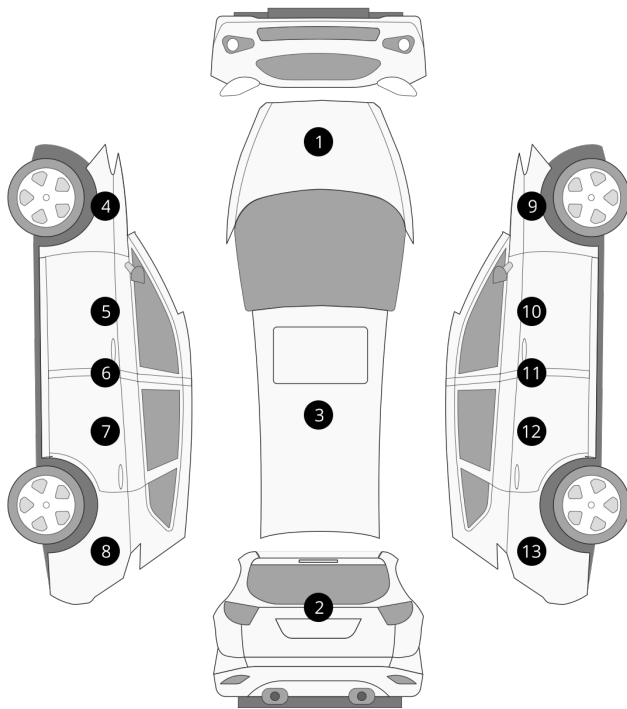


General Information

Date & Time: 13, Jun, 2025 17:58

Make	Toyota	Model	Wigo
YOM	2020	Odo Meter Reading	83,529
Registration No.	NFV5888	Chassis No.	MHKA4DF5KJ038853
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



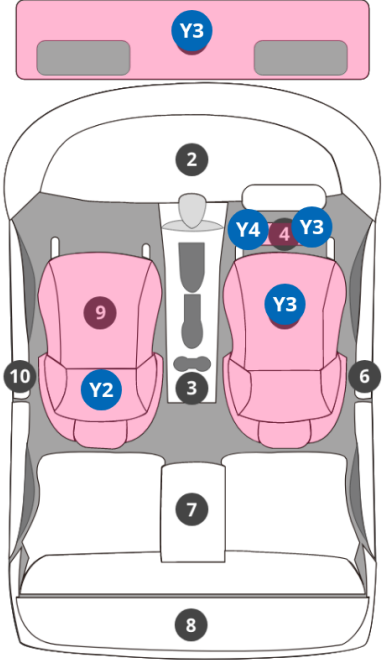
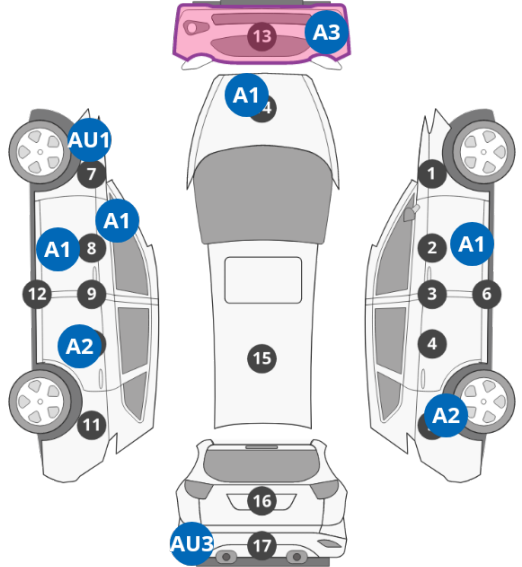
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	94.0	92	98	93
2	Boot Lid	93.5	91	98	91
3	Roof	85.4	80	89	89/85
4	Left Front Fender	127.0	136	127	118
5	Left Front Door	118.0	125	112	117
6	Center Panel Left				
7	Left Rear Door	111.6	110	111	114
8	Left Back Panel	111.6	113	117	105
9	Right Front Fender	90.1	92	91	88
10	Right Front Door	91.1	88	93	93
11	Center Panel Right				
12	Right Rear Door	87.5	90	87	85
13	Right Back Panel	87.4	92	87	84

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / (R) Front Floor Mat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Large / (L) Front Seat - Grime - Small	Remarks (R) Rear Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
high beam issue. trunk floor partially missing. Without warranty booklet, tools and jack. With spare tire. 1 key. With LTO PLATE