

General Information

Date & Time: 14, Jun, 2025 07:57

Make	Toyota	Model	Vios
YOM	2018	Odo Meter Reading	61,730
Registration No.	NAQ1180	Chassis No.	PA1B19F39J4061602
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



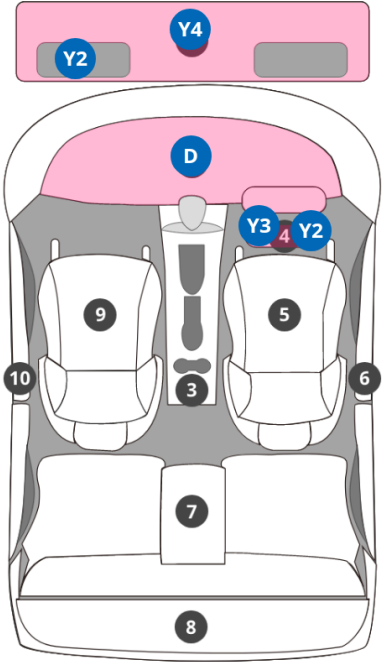
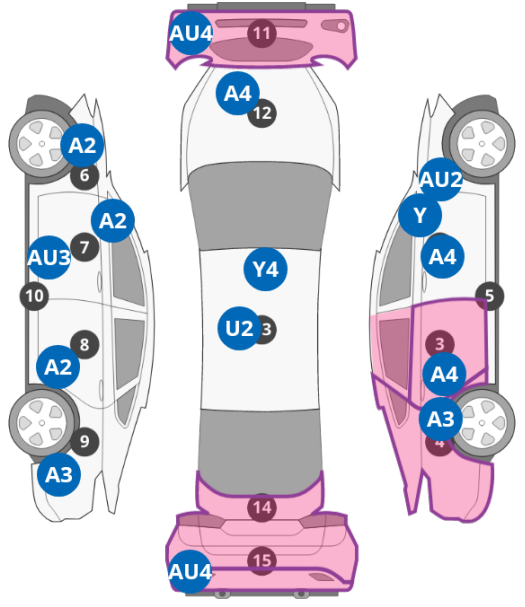
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	230.6	225	216	251
2	Boot Lid	224.6	229	223	222
3	Roof	108.7	107	113	114/101
4	Left Front Fender	317.6	319	321	313
5	Left Front Door	260.0	336	217	227
6	Center Panel Left				
7	Left Rear Door	234.0	243	236	223
8	Left Back Panel	299.6	295	292	312
9	Right Front Fender	249.3	224	222	302
10	Right Front Door	222.3	234	226	207
11	Center Panel Right				
12	Right Rear Door	255.6	343	210	214
13	Right Back Panel	233.3	211	223	266

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Sunvisor, Sunglass Holder - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Front Windshield - Damaged - Large / (L) Mirror - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Large / Roof - Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Large / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Mirror - Crack - Damaged
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
Crack Windshield. Loose right side mirror. Without warranty booklet and tools. With spare tire, jack and leather seatcover. 1 key. With LTO plate