

General Information

Date & Time: 29, Oct, 2024 14:02

Make	Toyota	Model	Rush
YOM	2024	Mileage	12,138
Registration No.	NFC9765	Chassis No.	MHKE8FF3PPK057945
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



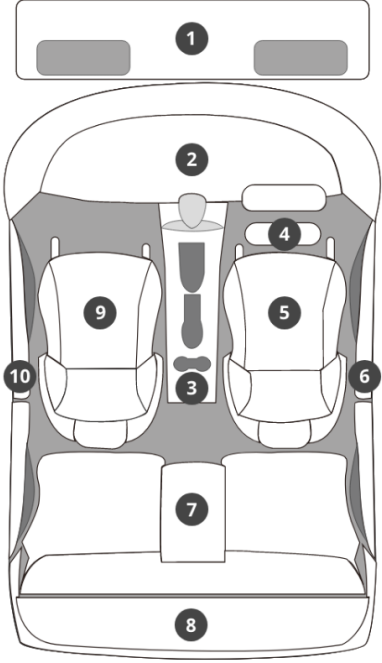
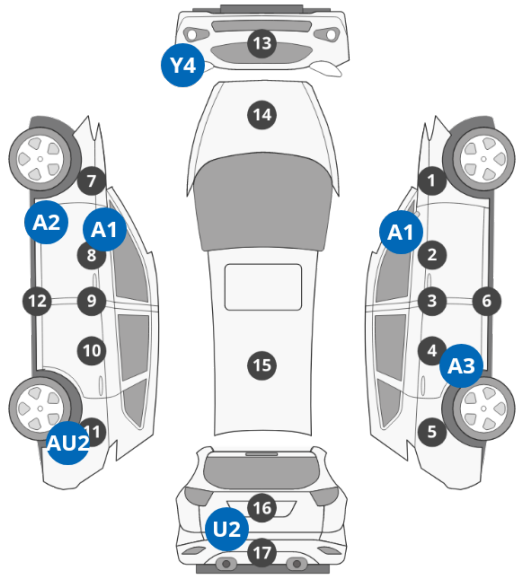
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	147.0	127	171	143
2	Boot Lid	102.6	104	106	98
3	Roof	103.3	97	103	103/110
4	Left Front Fender	322.0	634	189	143
5	Left Front Door	113.0	108	109	122
6	Center Panel Left				
7	Left Rear Door	144.0	155	146	131
8	Left Back Panel	145.0	182	123	130
9	Right Front Fender	146.3	138	152	149
10	Right Front Door	110.0	115	108	107
11	Center Panel Right				
12	Right Rear Door	105.6	100	102	115
13	Right Back Panel	104.0	105	100	107

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Defects not found	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / (L) Mirror - Scratch, Peeled - Minimal / (R) Mirror - Scratch, Peeled - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Dent - Small / (R) Rear Door, Molding - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
infotainment system not working/ reverse camera not working/ no audio/ minimal scratches around the exterior/ swirl marks present