

General Information

Date & Time: 19, Jun, 2025 14:18

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	5,330
Registration No.	NKK4702	Chassis No.	PA1B18F36R4273444
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



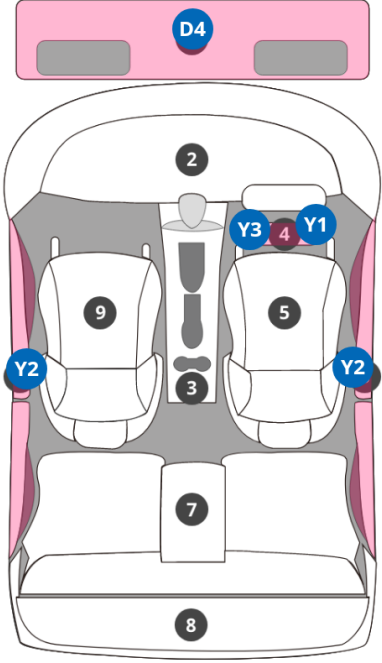
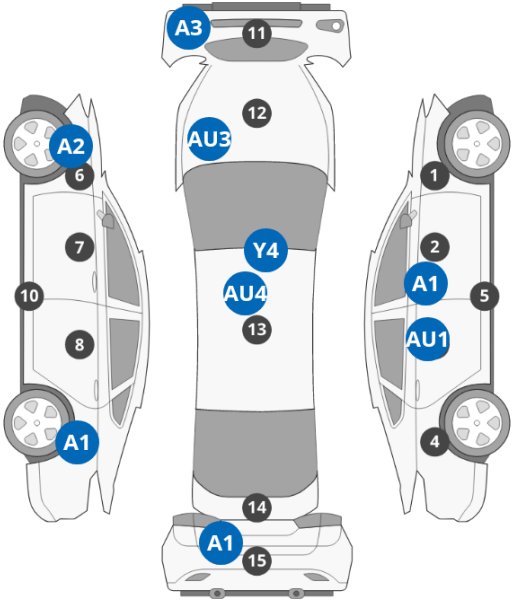
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	106	110	112
2	Boot Lid	105.3	102	105	109
3	Roof	99.4	102	100	99/97
4	Left Front Fender	99.1	100	100	98
5	Left Front Door	102.0	99	102	105
6	Center Panel Left				
7	Left Rear Door	102.0	106	101	99
8	Left Back Panel	110.6	126	102	104
9	Right Front Fender	103.3	102	105	103
10	Right Front Door	99.2	97	101	100
11	Center Panel Right				
12	Right Rear Door	99.1	101	96	101
13	Right Back Panel	101.0	100	97	106

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Crinkle - Large / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Grime - Medium	Remarks Roof - Scratch & Dent - Large / Front Windshield - Damaged - Large / Bonnet, Headlight - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
Damaged front windshield. With warranty booklet, spare tire, jack, tools and seat cover. 3 keys. no LTO plate.