

General Information

Date & Time: 27, Jun, 2025 09:41

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	28,331
Registration No.	NEO2186	Chassis No.	PA1B18F38M4153721
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



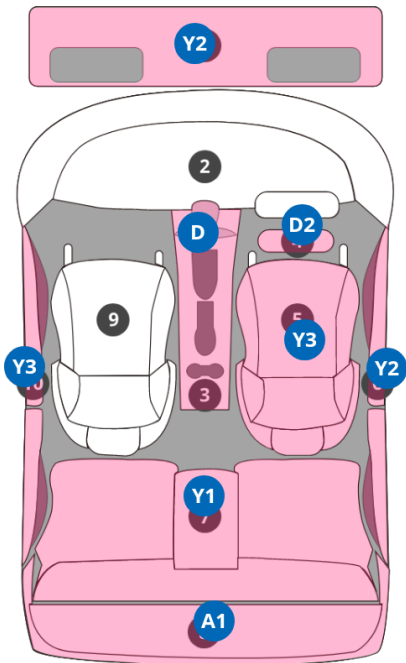
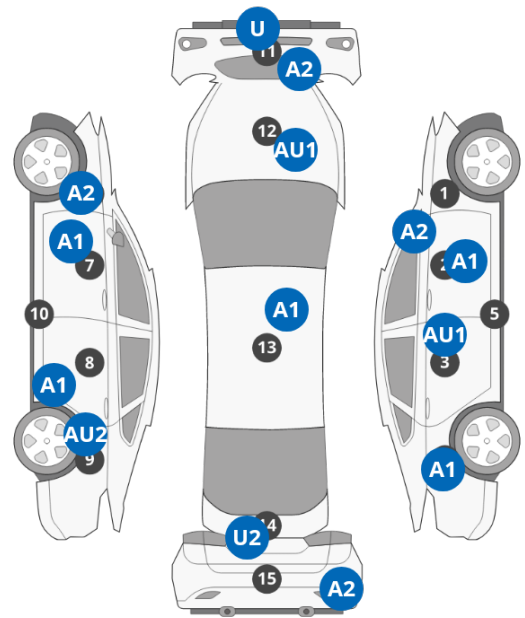
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.8	98	91	120
2	Boot Lid	119.0	120	113	124
3	Roof	96.8	100	94	94/99
4	Left Front Fender	98.3	101	97	97
5	Left Front Door	105.3	104	106	106
6	Center Panel Left				
7	Left Rear Door	105.3	106	104	106
8	Left Back Panel	106.6	107	109	104
9	Right Front Fender	144.3	165	136	132
10	Right Front Door	122.6	125	108	135
11	Center Panel Right				
12	Right Rear Door	134.3	126	128	149
13	Right Back Panel	103.6	103	109	99

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Minimal / Rear Seat - Grime - Minimal / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / Overall Interior - Worn as per age - Yes / Console, Switchs, Vents - Traces of Adhesive Tape - Yes	Remarks (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / Roof - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with warranty booklet, with jack and incomplete tools, with spare tire, weak battery