

General Information

Date & Time: 01, Jul, 2025 09:03

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	103,793
Registration No.	NHI1734	Chassis No.	PA1B18F32P4203002
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



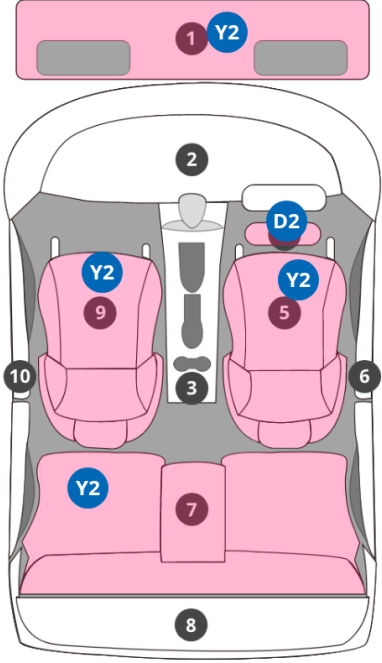
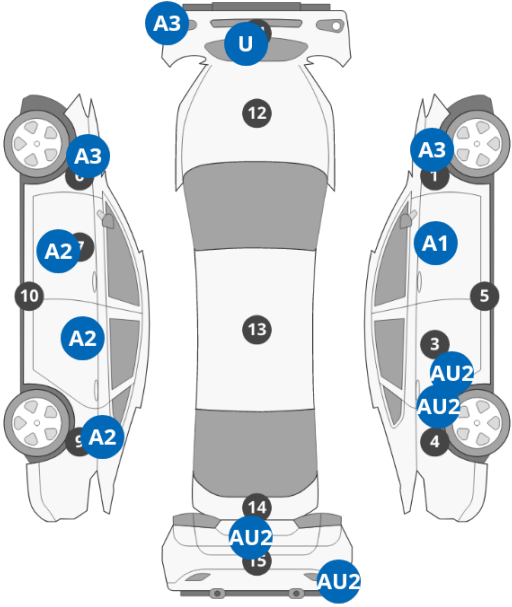
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	157.6	163	151	159
2	Boot Lid	123.3	127	123	120
3	Roof	114.5	109	104	124/121
4	Left Front Fender	105.6	110	101	106
5	Left Front Door	117.3	116	122	114
6	Center Panel Left				
7	Left Rear Door	151.3	221	116	117
8	Left Back Panel	115.6	122	119	106
9	Right Front Fender	108.6	104	108	114
10	Right Front Door	114.3	106	130	107
11	Center Panel Right				
12	Right Rear Door	111.6	112	109	114
13	Right Back Panel	107.6	112	102	109

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Floor Mat - Worked - Small	Remarks (L) Rear Door - Repair Traces - Yes / Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes
with LTO plate and Jack, Sparetire and incomplete tools. no warranty booklet, crack tail light and scratch headlight.