

General Information

Date & Time: 29, Oct, 2024 14:01

Make	Toyota	Model	Veloz
YOM	2023	Mileage	29,549
Registration No.	DAS2049	Chassis No.	MHFAB1BY8N3024872
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



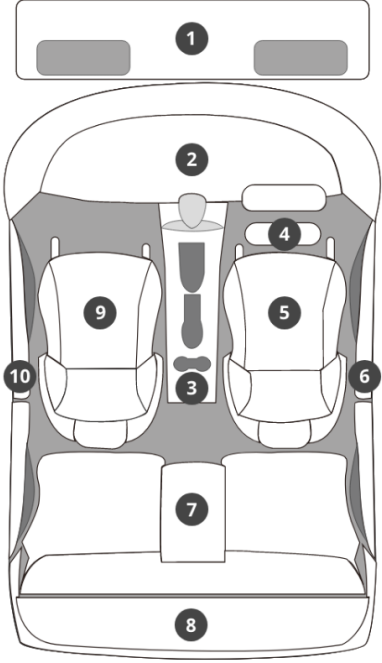
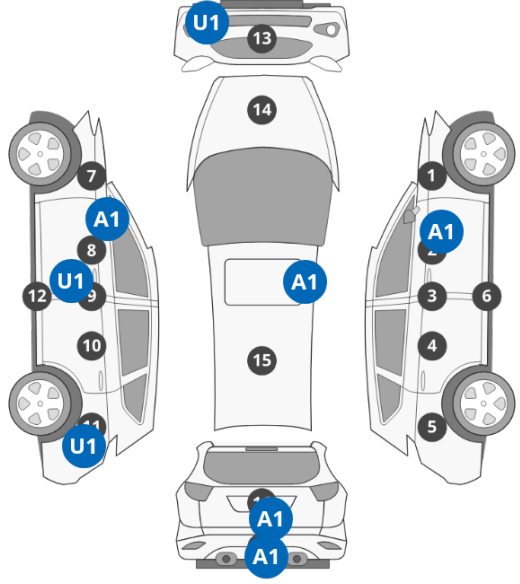
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.6	119	124	119
2	Boot Lid	131.3	156	132	106
3	Roof	122.5	117	138	112/123
4	Left Front Fender	115.6	110	118	119
5	Left Front Door	122.3	122	115	130
6	Center Panel Left				
7	Left Rear Door	134.3	136	115	152
8	Left Back Panel	130.3	150	119	122
9	Right Front Fender	110.6	119	110	103
10	Right Front Door	124.3	130	121	122
11	Center Panel Right				
12	Right Rear Door	135.3	141	136	129
13	Right Back Panel	137.3	122	137	153

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : A
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Defects not found	Remarks Front Bumper, Grille, Lamps - Dent - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Dent - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Dent - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes