

General Information

Date & Time: 01, Jul, 2025 18:43

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	45,837
Registration No.	DBG1550	Chassis No.	PA1B18F38N4198014
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



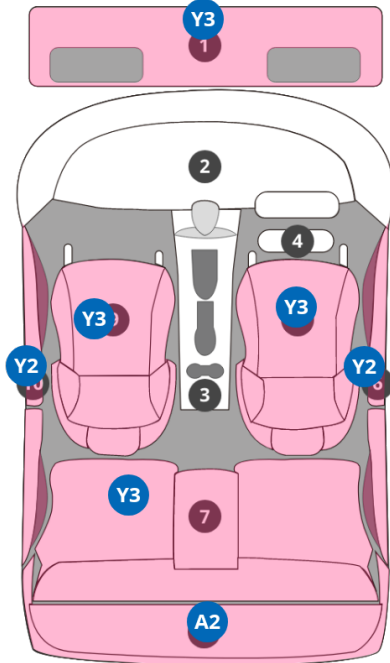
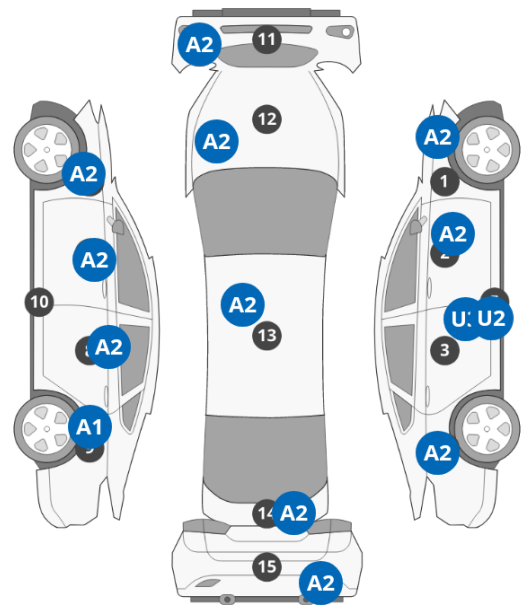
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	126.3	124	112	143
2	Boot Lid	115.6	119	107	121
3	Roof	110.5	122	100	114/106
4	Left Front Fender	116.6	111	121	118
5	Left Front Door	114.3	123	116	104
6	Center Panel Left				
7	Left Rear Door	116.0	116	115	117
8	Left Back Panel	127.3	139	119	124
9	Right Front Fender	110.6	113	112	107
10	Right Front Door	115.0	110	123	112
11	Center Panel Right				
12	Right Rear Door	115.3	109	116	121
13	Right Back Panel	117.0	117	113	121

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / Ceiling - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Seat - Grime - Medium / (L) Front Trim - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Dent - Medium / (R) Step, In-panel, Side Spoiler - Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Small / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no LTO plate, no warranty booklet, with jack, incomplete tools, with spare tire, tail light scratch