

General Information

Date & Time: 02, Jul, 2025 09:49

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	14,143
Registration No.	DBJ5225	Chassis No.	PA1B18F31P4221510
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



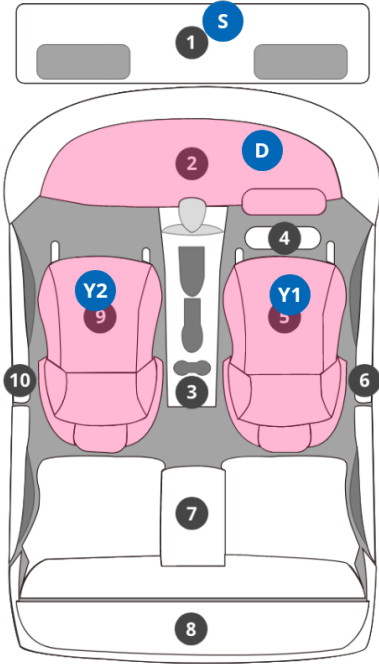
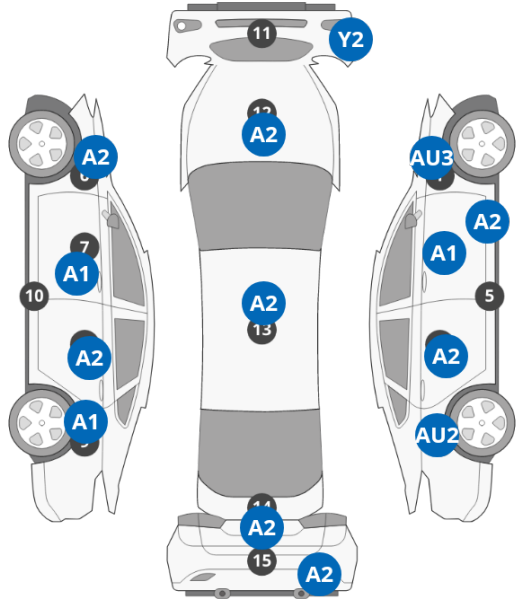
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	125.0	134	111	130
2	Boot Lid	125.6	122	129	126
3	Roof	112.5	114	106	107/123
4	Left Front Fender	119.3	119	116	123
5	Left Front Door	113.0	112	116	111
6	Center Panel Left				
7	Left Rear Door	113.3	116	111	113
8	Left Back Panel	112.3	113	111	113
9	Right Front Fender	113.6	122	109	110
10	Right Front Door	107.6	107	109	107
11	Center Panel Right				
12	Right Rear Door	113.3	110	115	115
13	Right Back Panel	120.0	115	112	133

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Overall Interior - Smell - Yes	Remarks (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet and LTO plate, Jack and sparetire and incomplete tools. partially missing front bumper. tow hook cover, scratch headlight and tail light.