

General Information

Date & Time: 18, Jun, 2025 11:00

Make	Lexus	Model	RX350
YOM	2017	Odo Meter Reading	100,687
Registration No.	NAC8869	Chassis No.	JTJZZMCA4G2001088
CC	3.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Gray		

Body / Panel Condition



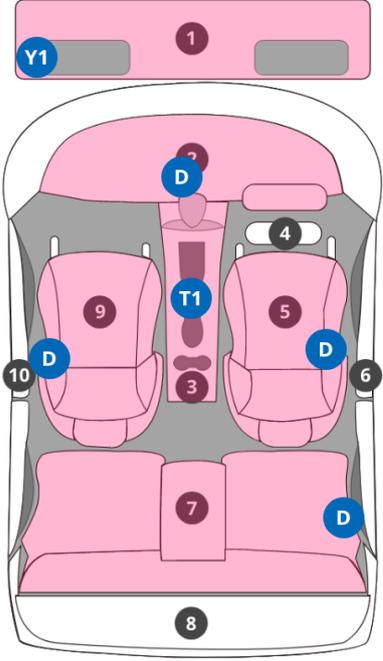
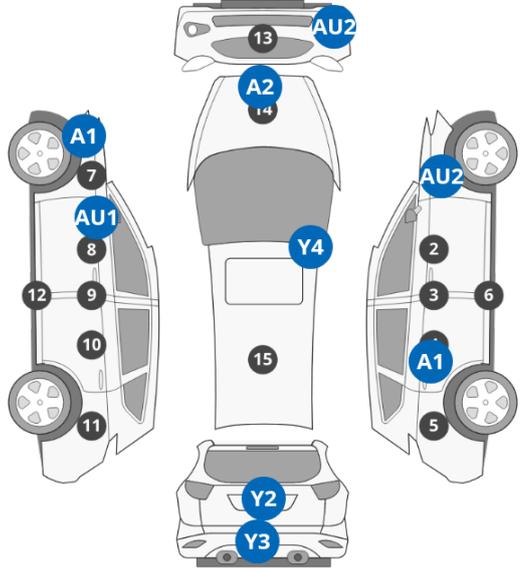
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.6	119	127	125
2	Boot Lid	201.3	209	196	199
3	Roof	127.2	125	126	130/128
4	Left Front Fender	130.0	130	129	131
5	Left Front Door	128.0	129	128	127
6	Center Panel Left				
7	Left Rear Door	131.0	133	126	134
8	Left Back Panel	136.3	138	135	136
9	Right Front Fender	127.6	126	128	129
10	Right Front Door	129.6	129	125	135
11	Center Panel Right				
12	Right Rear Door	125.3	129	122	125
13	Right Back Panel	128.6	131	127	128

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Worn - Yes / (R) Front Seat - Worn - Yes / (L) Front Seat - Worn - Yes / Console, Switchs, Vents - Cigarette Burns - Burnt Minimal / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Minimal</p>	<p>Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Trunk Hood, Rear Gate - Crack, Gap - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / Front Windshield - Damaged - Large</p>
Frame Evaluation : A	Functional Evaluation : D
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, with jack and tools, with spare tire, with LTO plate, weak battery, warning lamps on, air-conditioning system issue (only heater working), remote key issue, crack on front windshield, rear emblem crack</p>