

General Information

Date & Time: 20, Jun, 2025 14:33

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	47,617
Registration No.	NFC8385	Chassis No.	PA1B18F35P4222577
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



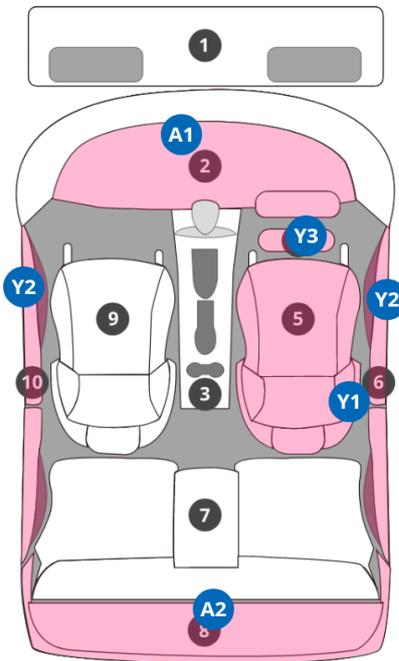
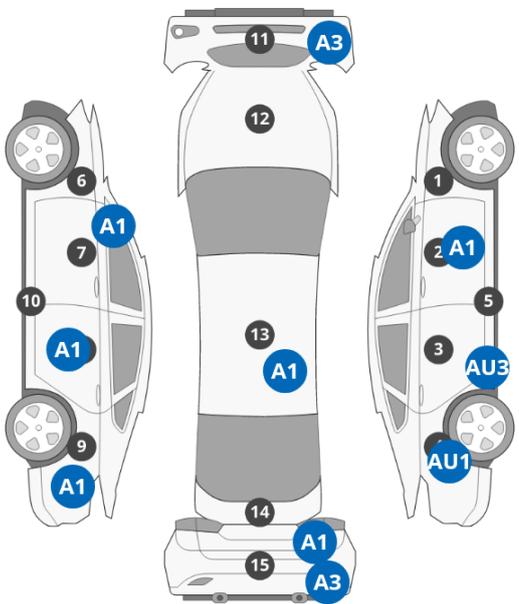
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.7	102	99	95
2	Boot Lid	94.8	93	95	97
3	Roof	91.4	94	87	86/99
4	Left Front Fender	93.0	91	90	98
5	Left Front Door	93.8	97	91	93
6	Center Panel Left				
7	Left Rear Door	96.5	102	96	91
8	Left Back Panel	96.3	102	96	91
9	Right Front Fender	96.3	101	93	96
10	Right Front Door	97.9	104	95	95
11	Center Panel Right				
12	Right Rear Door	96.8	90	93	107
13	Right Back Panel	92.8	88	94	97

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Grime - Medium / (R) Front Seat - Grime - Minimal / Dashboard - Worn, Scratch, Cut, Crack - Minimal / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small</p>	<p>Remarks Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Roof - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with jack and No tools/No warranty booklet/No reverse camera</p>