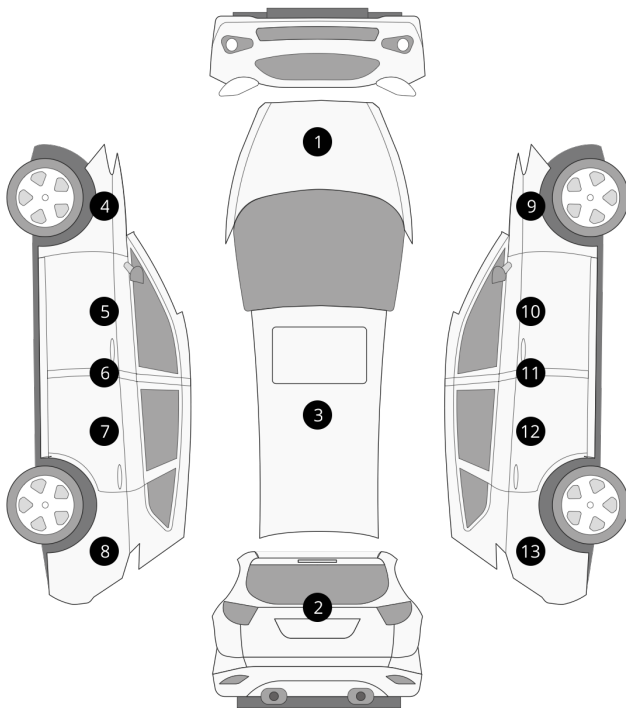


General Information

Date & Time: 25, Jun, 2025 13:34

Make	Suzuki	Model	Carry
YOM	2024	Odo Meter Reading	19,224
Registration No.	NKB6866	Chassis No.	MHYDC61T3RJ211992
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Van
Colour	White		

Body / Panel Condition



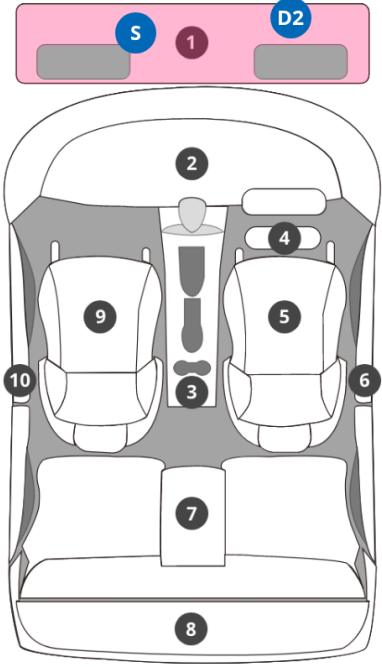
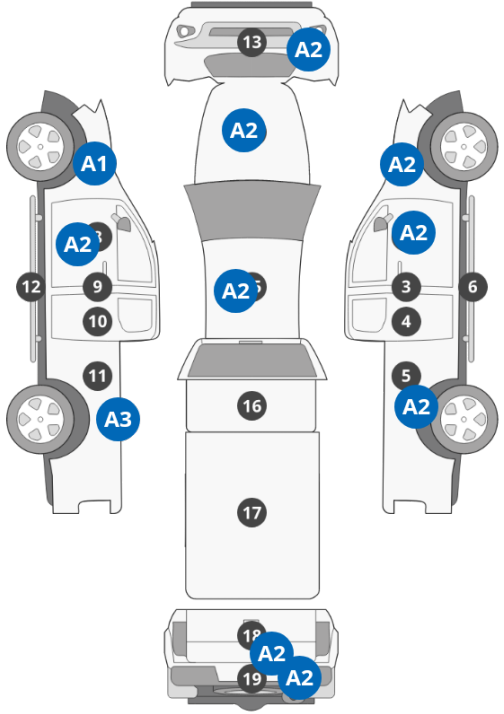
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	118	109	110
2	Boot Lid	118.3	122	104	129
3	Roof	108.5	119	110	114/91
4	Left Front Fender	114.6	105	115	124
5	Left Front Door	106.3	111	107	101
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	211.0	165	258	210
9	Right Front Fender	115.6	111	118	118
10	Right Front Door	97.4	95	101	97
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	196.3	168	203	218

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Crinkle - Small / Overall Interior - Smell - Yes	Remarks (L) Rear Corner Panel - Repair Traces - Yes / (R) Rear Corner Panel - Repair Traces - Yes / (L) Side Gate - Scratch - Medium / Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Side Gate - Scratch - Small / (R) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Front Panel - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with spare tire. no warranty booklet and LTO plate, Jack and tools. scratch tail light and headlight.