

General Information

Date & Time: 24, Jun, 2025 18:36

Make	Suzuki	Model	Carry
YOM	2024	Odo Meter Reading	5,627
Registration No.	NKE7292	Chassis No.	MHYDC61T8SJ210746
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Van
Colour	White		

Body / Panel Condition



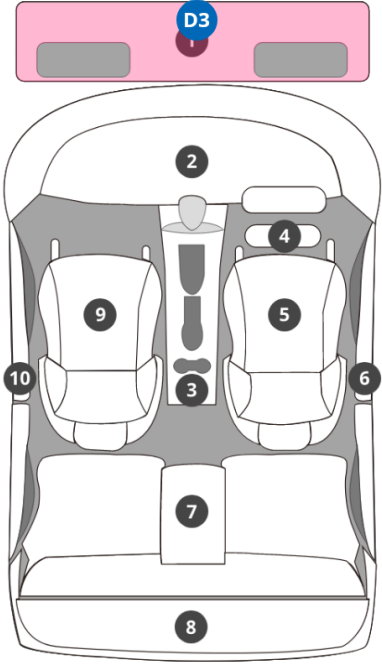
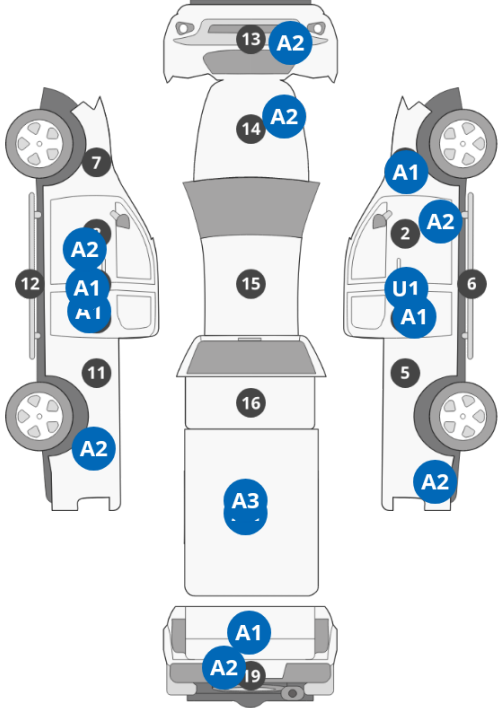
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.3	127	113	115
2	Boot Lid	100.5	120	88	93
3	Roof	101.3	108	102	108/87
4	Left Front Fender	118.3	111	122	122
5	Left Front Door	109.3	108	115	105
6	Center Panel Left	106.0	114	104	100
7	Left Rear Door	87.6	78	112	73
8	Left Back Panel	82.9	77	100	72
9	Right Front Fender	120.3	117	123	121
10	Right Front Door	108.0	109	110	105
11	Center Panel Right	98.5	93	114	88
12	Right Rear Door	75.1	73	69	83
13	Right Back Panel	80.1	80	82	78

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Loose, Deformed - Medium	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Center Panel - Dent - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Side Gate - Scratch - Small / Roof - Scratch - Small / Cargo Bed Floor - Scratch - Medium / Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Side Gate - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Center Panel - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Front Panel - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
with LTO plate, with warranty booklet, no jack, with tools, with spare tire