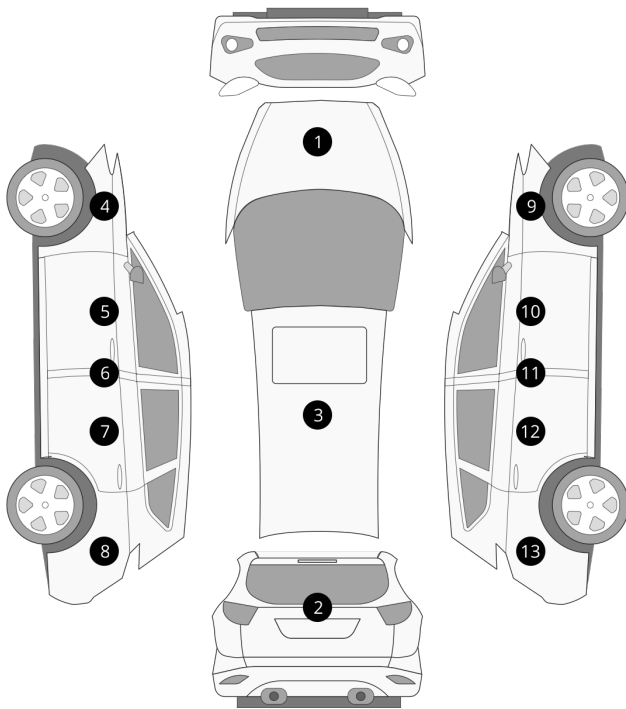


General Information

Date & Time: 24, Jun, 2025 15:02

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	28,810
Registration No.	DBJ9197	Chassis No.	PA1B18F3XP4227578
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



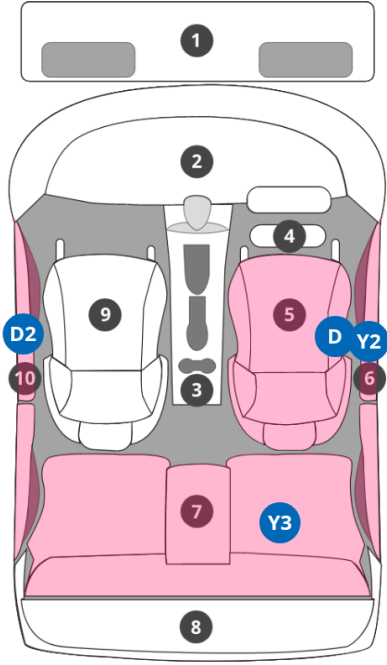
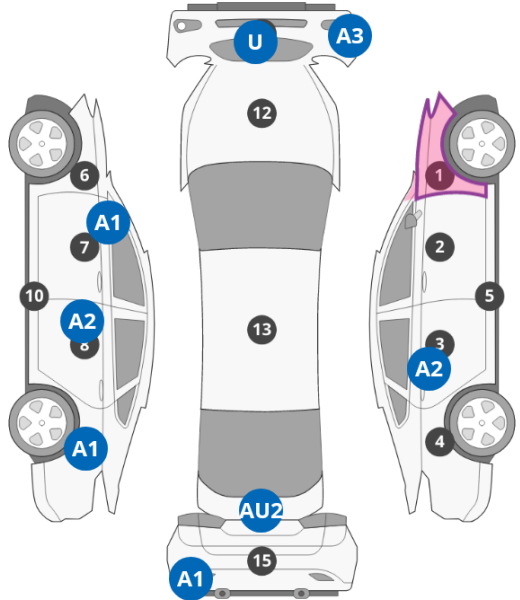
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.0	117	116	112
2	Boot Lid	107.0	105	104	112
3	Roof	102.2	102	106	101/100
4	Left Front Fender	122.6	146	121	101
5	Left Front Door	108.3	112	104	109
6	Center Panel Left				
7	Left Rear Door	111.0	119	113	101
8	Left Back Panel	115.3	126	117	103
9	Right Front Fender	125.4	99	115	162
10	Right Front Door	97.3	97	96	99
11	Center Panel Right				
12	Right Rear Door	100.9	106	98	99
13	Right Back Panel	102.9	98	107	104

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Seat - Worn - Yes / (L) Front Trim - Worked - Small	Remarks (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Repair mark - Yes
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

with warranty booklet, with jack, no tools, with spare tire, with LTO plate