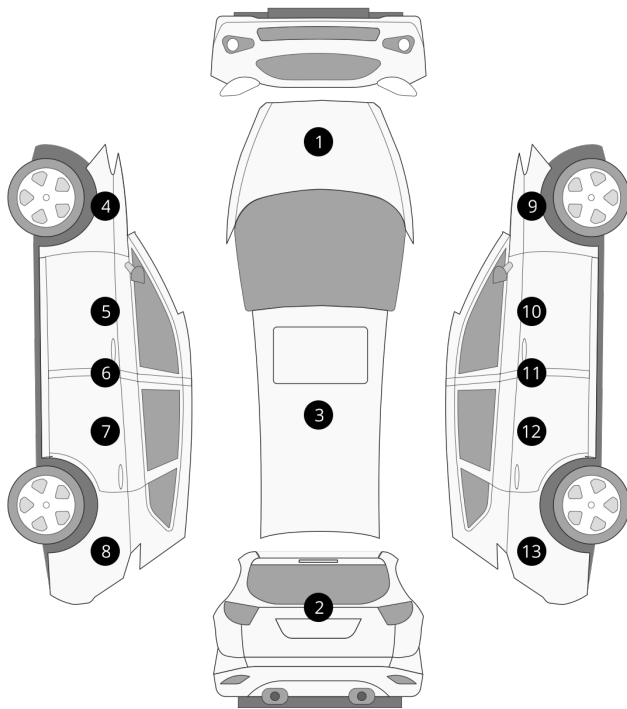


General Information

Date & Time: 20, Jun, 2025 14:01

Make	Mitsubishi	Model	Mirage
YOM	2023	Odo Meter Reading	18,025
Registration No.	NIF7957	Chassis No.	PAEA13TJPNA002698
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



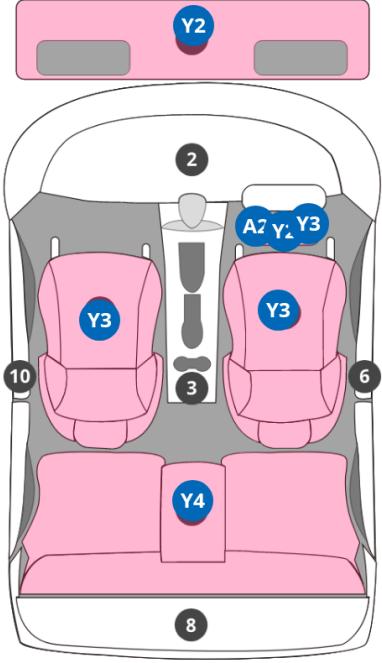
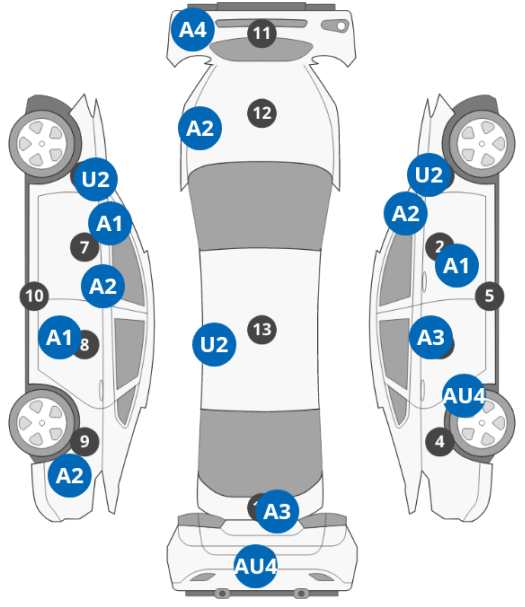
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	159.0	149	169	159
2	Boot Lid	122.6	108	125	135
3	Roof	109.0	101	106	114/115
4	Left Front Fender	148.3	147	159	139
5	Left Front Door	111.6	109	112	114
6	Center Panel Left				
7	Left Rear Door	103.0	109	102	98
8	Left Back Panel	116.0	112	118	118
9	Right Front Fender	108.3	106	109	110
10	Right Front Door	145.3	151	142	143
11	Center Panel Right				
12	Right Rear Door	194.0	177	193	212
13	Right Back Panel	110.3	109	110	112

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large / (L) Front Floor Mat - Cut, Crack - Small / Mat Other - Grime - Small / (R) Front Floor Mat - Grime - Medium	Remarks (R) Rear Door - Repair Traces - Yes / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Dent - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Dent - Small / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With warranty booklet, spare tire, jack and tools. Without seat cover. 1 key. with LTO plate