

General Information

Date & Time: 27, Jun, 2025 13:34

Make	Toyota	Model	Wigo
YOM	2021	Odo Meter Reading	60,683
Registration No.	CBM4039	Chassis No.	MHKA4DF5FMJ054643
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	White		

Body / Panel Condition



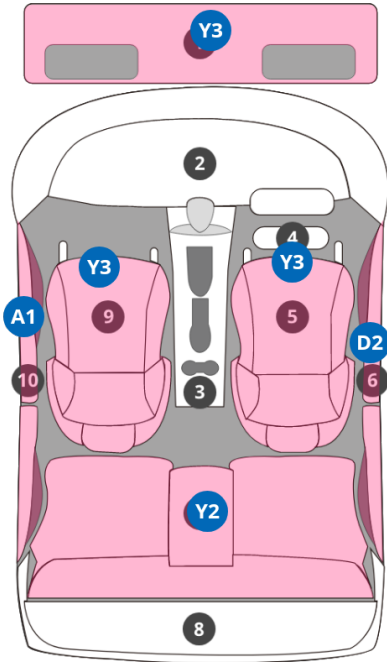
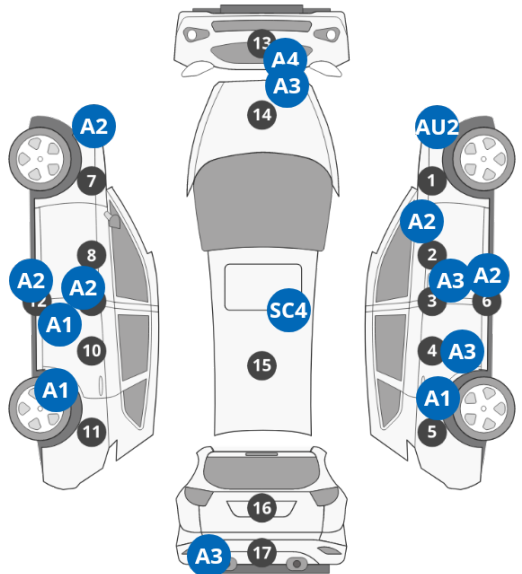
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	82.3	81	92	74
2	Boot Lid	90.0	88	95	87
3	Roof	67.8	61	76	68/66
4	Left Front Fender	87.2	78	80	104
5	Left Front Door	79.7	80	80	79
6	Center Panel Left				
7	Left Rear Door	78.6	87	80	70
8	Left Back Panel	75.3	65	73	87
9	Right Front Fender	80.0	78	85	77
10	Right Front Door	84.9	90	84	80
11	Center Panel Right				
12	Right Rear Door	85.1	85	78	92
13	Right Back Panel	84.4	87	81	85

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (R) Front Seat - Grime - Medium / (R) Front Trim - Worked - Small / (L) Front Trim - Cut, Crack - Minimal / Ceiling - Grime - Medium / (L) Front Seat - Grime - Medium	Remarks (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Medium / Roof - Rust, Corrosion - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

with warranty booklet, with jack, no tools, with spare tire, with LTO plate, scratches on headlight, suncrack tail light, trunk room partially missing