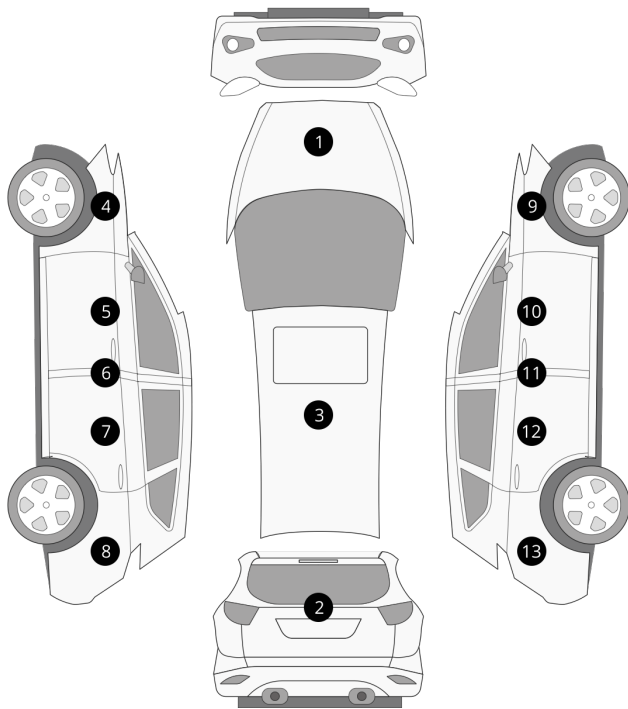


General Information

Date & Time: 30, Jun, 2025 10:11

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	14,991
Registration No.	CBU1002	Chassis No.	PA1B18F37P4210933
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



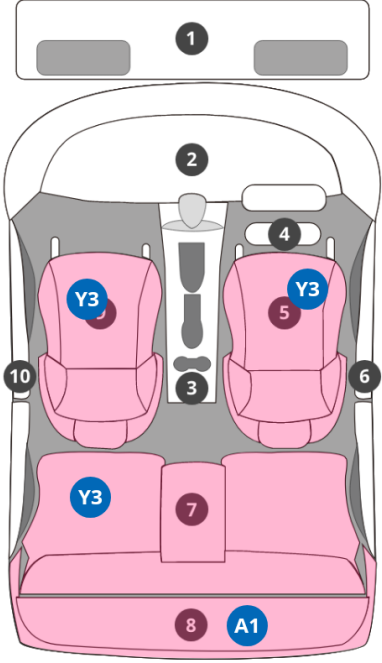
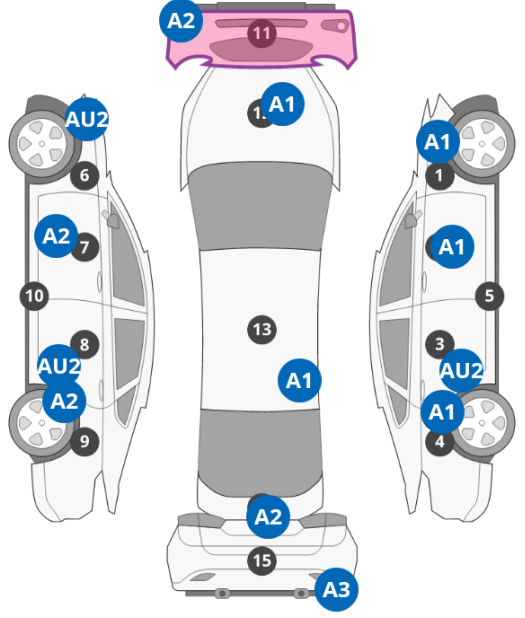
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.3	114	105	115
2	Boot Lid	118.0	120	115	119
3	Roof	104.5	117	102	98/101
4	Left Front Fender	98.9	97	94	106
5	Left Front Door	99.9	105	94	101
6	Center Panel Left				
7	Left Rear Door	103.6	109	104	98
8	Left Back Panel	105.3	105	100	111
9	Right Front Fender	98.4	106	92	97
10	Right Front Door	96.3	97	95	97
11	Center Panel Right				
12	Right Rear Door	102.9	93	105	111
13	Right Back Panel	102.7	107	96	105

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Minimal / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with warranty booklet, with jack, no tools, with spare tire