

General Information

Date & Time: 27, Jun, 2025 11:09

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	67,719
Registration No.	DAQ5334	Chassis No.	PA1B18F37N4175646
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



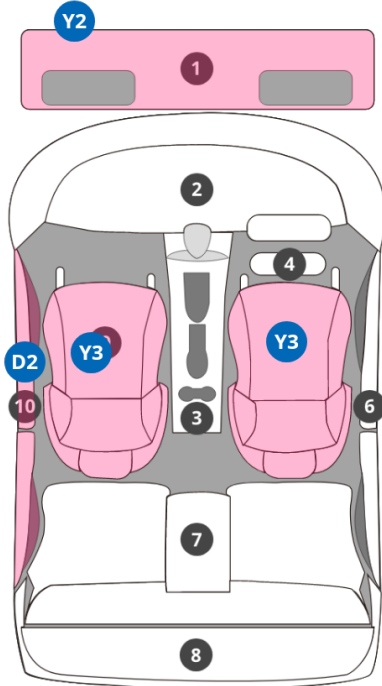
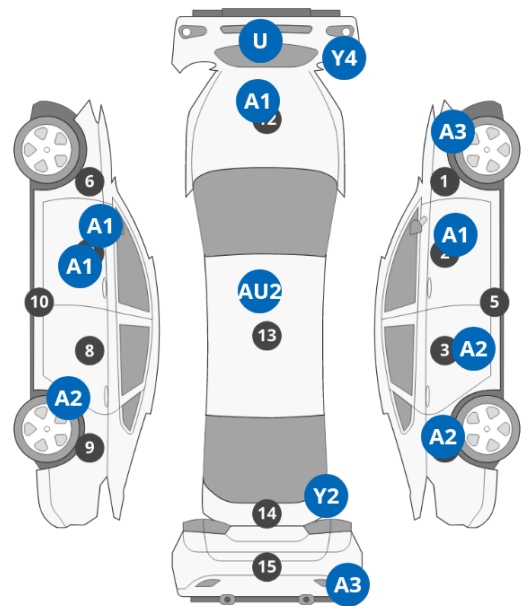
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.3	112	137	118
2	Boot Lid	113.6	114	106	121
3	Roof	100.2	102	105	102/92
4	Left Front Fender	95.6	97	98	92
5	Left Front Door	100.3	99	102	100
6	Center Panel Left				
7	Left Rear Door	96.1	101	96	91
8	Left Back Panel	107.6	111	111	101
9	Right Front Fender	100.0	98	102	100
10	Right Front Door	101.0	98	103	102
11	Center Panel Right				
12	Right Rear Door	99.9	95	101	104
13	Right Back Panel	101.6	104	95	106

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Trim - Worked - Small / Ceiling - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Crack, Gap - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet, with jack and tools, with spare tire, with LTO plate