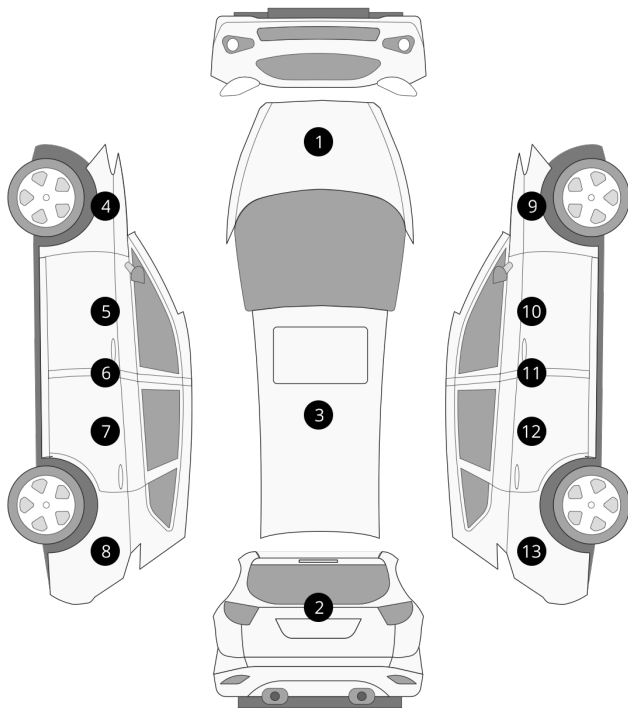


## General Information

Date & Time: 27, Jun, 2025 14:51

|                  |         |                   |                   |
|------------------|---------|-------------------|-------------------|
| Make             | Toyota  | Model             | Wigo              |
| YOM              | 2022    | Odo Meter Reading | 23,988            |
| Registration No. | NHB2281 | Chassis No.       | MHKA4DE5FNJ017413 |
| CC               | 1.0     | Transmission      | M/T               |
| Fuel Type        | Gas     | Type of Body      | Hatchback         |
| Colour           | Black   |                   |                   |

## Body / Panel Condition



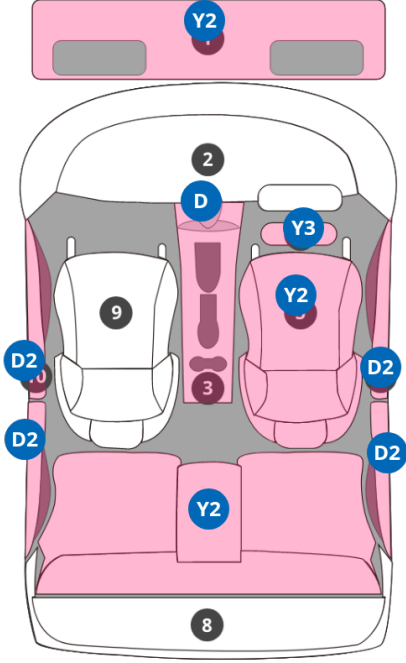
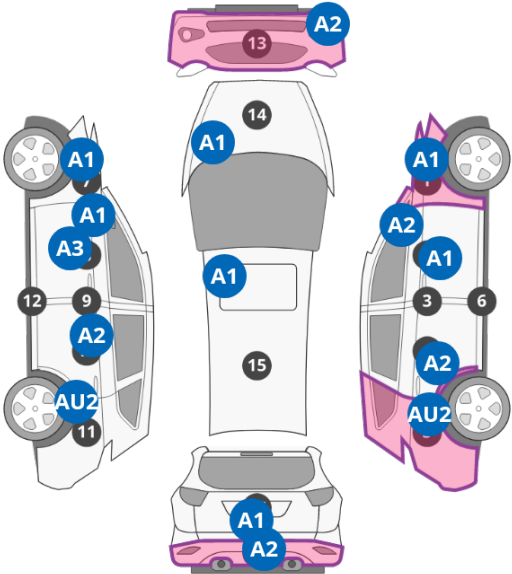
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 94.4          | 97     | 100    | 87       |
| 2  | Boot Lid           | 113.3         | 105    | 119    | 116      |
| 3  | Roof               | 103.6         | 79     | 155    | 87/94    |
| 4  | Left Front Fender  | 173.3         | 178    | 181    | 161      |
| 5  | Left Front Door    | 171.6         | 173    | 163    | 179      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 150.3         | 164    | 142    | 145      |
| 8  | Left Back Panel    | 95.5          | 101    | 89     | 97       |
| 9  | Right Front Fender | 85.2          | 90     | 90     | 76       |
| 10 | Right Front Door   | 109.3         | 104    | 108    | 116      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 106.0         | 110    | 105    | 103      |
| 13 | Right Back Panel   | 106.8         | 112    | 100    | 109      |

## Overall Evaluation :

C

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

|                                                                                                                                                                                                                                                                                                                                                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Interior Evaluation :</b> <span style="color: red; font-weight: bold;">C</span>                                                                                                                                                                                                                                                             | <b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold;">D</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>                                                                                             |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |
| <b>Remarks</b><br>(R) Front Floor Mat - Grime - Medium / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Small / (L) Rear Trim - Worked - Small / (R) Rear Trim - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Console, Switches, Vents - Traces of Adhesive Tape - Yes | <b>Remarks</b><br>(R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal |
| <b>Frame Evaluation :</b> <span style="color: red; font-weight: bold;">A</span>                                                                                                                                                                                                                                                                | <b>Functional Evaluation :</b> <span style="color: red; font-weight: bold;">A</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |
| <b>Remarks</b><br>Defects not found                                                                                                                                                                                                                                                                                                            | <b>Remarks</b><br>Spare Key - Issue - Unexist                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |

|                                                                          |
|--------------------------------------------------------------------------|
| <b>Inspector Notes</b>                                                   |
| with LTO plate, no warranty booklet, no jack and tools, with rim no tire |