

General Information

Date & Time: 27, Jun, 2025 14:02

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	16,105
Registration No.	NHJ6567	Chassis No.	PA1B18F36P4219283
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



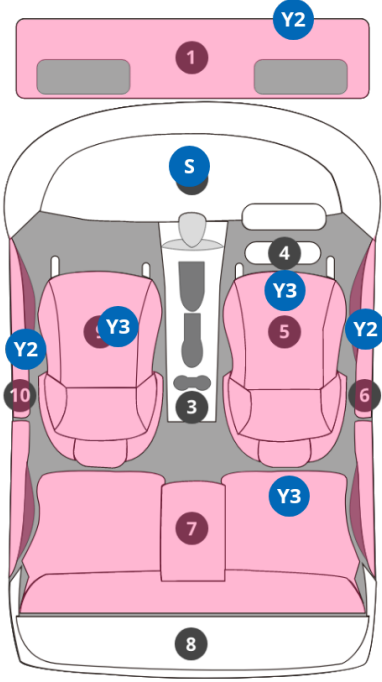
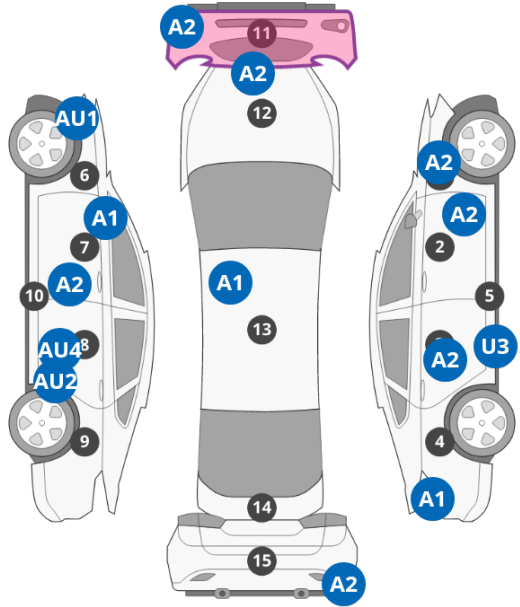
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	126.0	118	115	145
2	Boot Lid	116.6	113	115	122
3	Roof	106.0	108	104	97/115
4	Left Front Fender	158.0	164	156	154
5	Left Front Door	176.0	177	166	185
6	Center Panel Left				
7	Left Rear Door	101.3	116	97	91
8	Left Back Panel	108.3	110	108	107
9	Right Front Fender	100.7	101	96	105
10	Right Front Door	98.8	99	98	100
11	Center Panel Right				
12	Right Rear Door	102.3	102	100	105
13	Right Back Panel	105.6	100	109	108

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Overall Interior - Smell - Yes / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / Ceiling - Grime - Small	Remarks (L) Front Door - Repair Traces - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet ,with jack and tools, with spare tire, with LTO plate, scratches on tail light