

General Information

Date & Time: 27, Jun, 2025 08:12

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	15,042
Registration No.	NHR9181	Chassis No.	PA1B18F3XP4235194
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



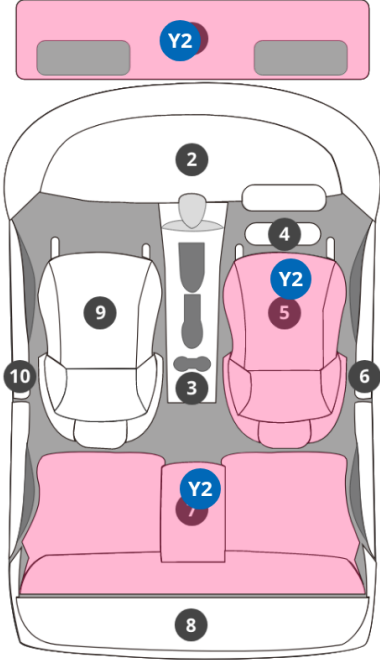
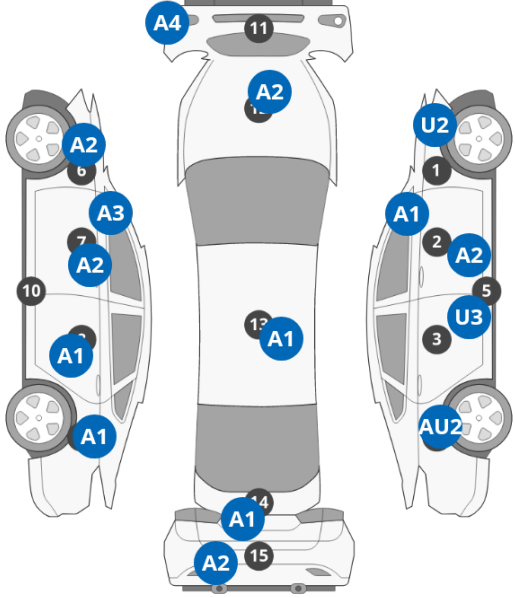
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.8	120	95	106
2	Boot Lid	108.1	97	106	122
3	Roof	91.0	91	95	84/94
4	Left Front Fender	92.2	89	90	99
5	Left Front Door	93.8	94	92	96
6	Center Panel Left				
7	Left Rear Door	97.1	99	95	98
8	Left Back Panel	102.4	117	98	92
9	Right Front Fender	97.5	97	97	98
10	Right Front Door	97.9	96	101	97
11	Center Panel Right				
12	Right Rear Door	97.7	101	95	97
13	Right Back Panel	103.9	100	97	115

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Small	Remarks (R) Front Fender, Molding - Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / Roof - Scratch - Minimal / (L) Mirror - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

with LTO plate, with warranty booklet, with jack, no tools, with spare tire
