

General Information

Date & Time: 23, Jun, 2025 18:49

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	12,603
Registration No.	NHR3094	Chassis No.	PA1B18F31P4228098
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



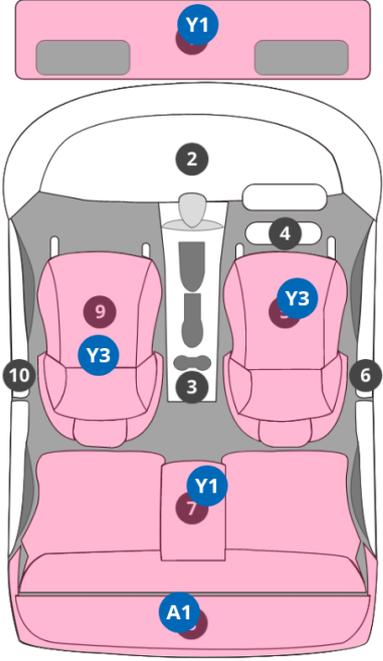
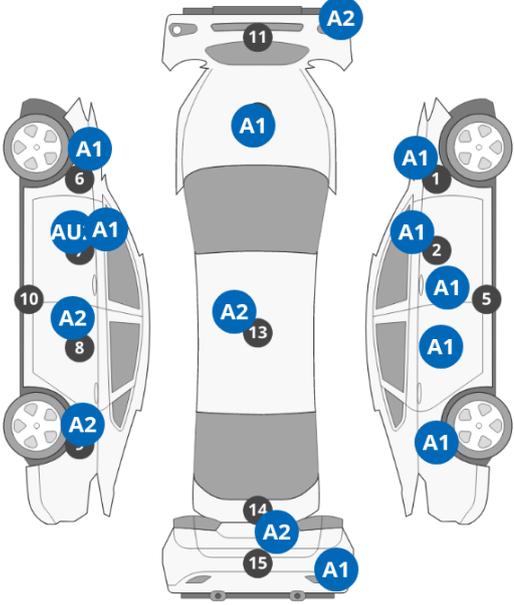
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.3	111	97	105
2	Boot Lid	104.3	98	98	117
3	Roof	89.4	90	87	90/91
4	Left Front Fender	95.0	103	87	96
5	Left Front Door	97.3	96	100	97
6	Center Panel Left				
7	Left Rear Door	96.8	98	93	100
8	Left Back Panel	103.4	112	97	101
9	Right Front Fender	93.8	100	86	96
10	Right Front Door	97.2	94	101	97
11	Center Panel Right				
12	Right Rear Door	97.6	95	95	103
13	Right Back Panel	101.6	101	104	100

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Minimal / Rear Seat - Grime - Minimal / Ceiling - Grime - Minimal / (L) Front Seat - Grime - Medium</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Roof - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, no warranty booklet, no jack and tools, with spare tire</p>