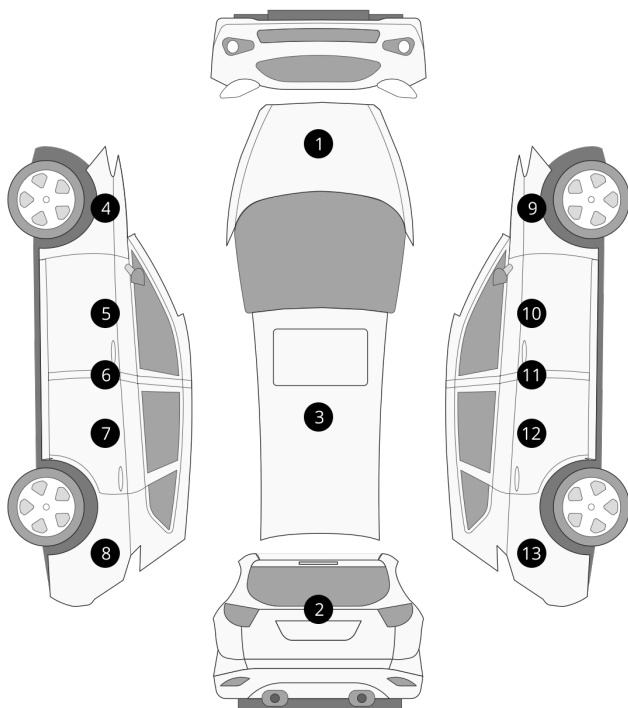


General Information

Date & Time: 02, Jul, 2025 13:08

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	81,646
Registration No.	NIE2185	Chassis No.	PA1B18F3XN4186835
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



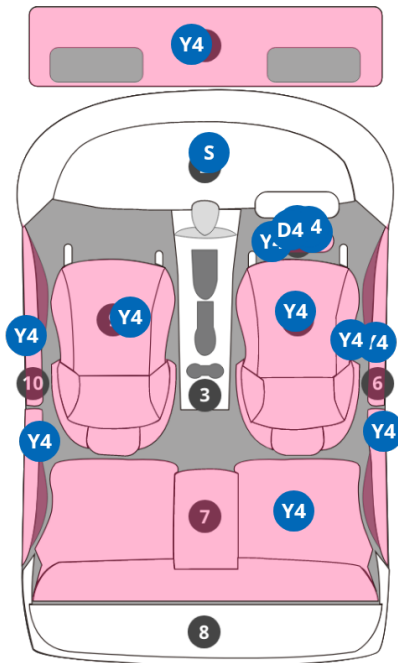
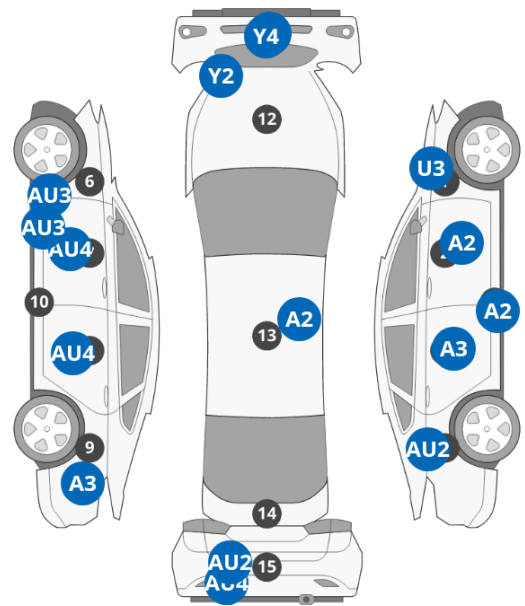
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	437.6	1,066	129	118
2	Boot Lid	120.3	124	118	119
3	Roof	113.7	121	110	104/120
4	Left Front Fender	116.6	125	113	112
5	Left Front Door	113.6	113	111	117
6	Center Panel Left				
7	Left Rear Door	114.6	123	112	109
8	Left Back Panel	119.0	116	119	122
9	Right Front Fender	787.0	496	1,061	804
10	Right Front Door	111.3	109	114	111
11	Center Panel Right				
12	Right Rear Door	118.6	118	116	122
13	Right Back Panel	122.3	118	115	134

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Large / Rear Seat - Grime - Large / Overall Interior - Smell - Yes / (L) Front Floor Mat - Grime - Large / (R) Front Floor Mat - Grime - Large / Mat Other - Grime - Large / (R) Front Trim - Grime - Large / (R) Rear Trim - Grime - Large / (L) Front Trim - Grime - Large / (L) Rear Trim - Grime - Large / (R) Front Floor Mat - Worked - Large / (R) Front Seat belt - Grime - Large / (L) Front Floor Mat - Worked - Large / Overall Interior - Worn as per age - Yes / Ceiling - Grime - Large	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch & Dent - Medium / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Crack, Gap - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, with jack, no tools, with spare tire, with LTO plate, foul smell, scratches on tail light, possible flooding, mold on overall interior