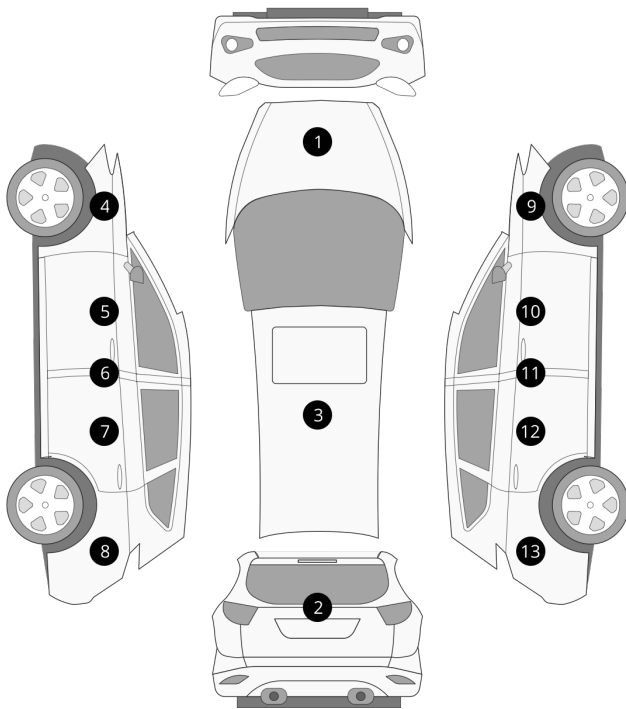


General Information

Date & Time: 23, Jun, 2025 10:29

Make	Mitsubishi	Model	Mirage
YOM	2019	Odo Meter Reading	59,799
Registration No.	NFT4304	Chassis No.	PAEA13TJKKA012603
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



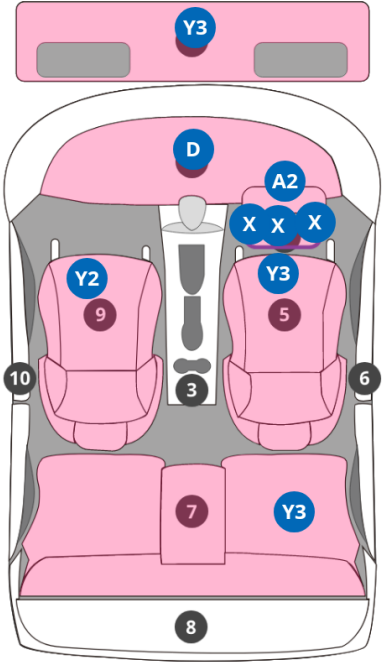
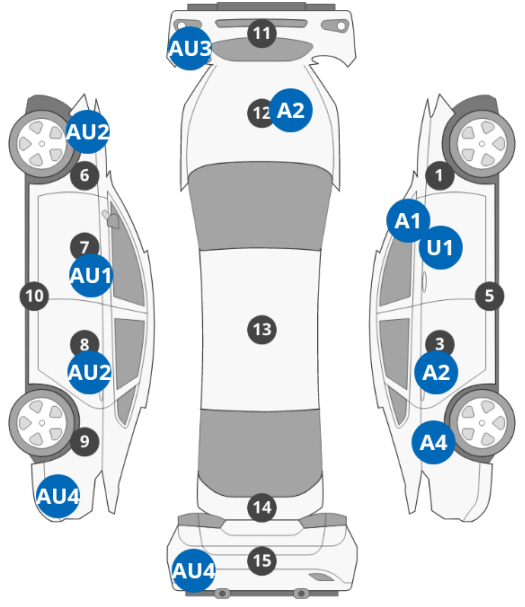
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	278.3	262	302	271
2	Boot Lid	226.3	203	213	263
3	Roof	127.7	127	131	121/132
4	Left Front Fender	183.0	176	192	181
5	Left Front Door	171.0	185	165	163
6	Center Panel Left				
7	Left Rear Door	166.3	175	171	153
8	Left Back Panel	193.6	219	187	175
9	Right Front Fender	261.3	259	257	268
10	Right Front Door	197.6	200	188	205
11	Center Panel Right				
12	Right Rear Door	161.3	141	155	188
13	Right Back Panel	229.0	198	218	271

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / Mat Other - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small / Steering Wheel - Worn, Peel, Crack - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Dent - Minimal / (R) Rear Fender, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Small
Frame Evaluation : B	Functional Evaluation : C
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Shift Shock - Function - Weak / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
Crack taillight. Gap at front and rear bumper. With warranty booklet, spare tire and jack. Without tools and seat cover. 1 key. With LTO plate