

General Information

Date & Time: 05, Nov, 2024 16:26

Make	Toyota	Model	Rush
YOM	2023	Mileage	25,143
Registration No.	NHC9056	Chassis No.	MHKE8FF3PNK050970
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Red		

Body / Panel Condition



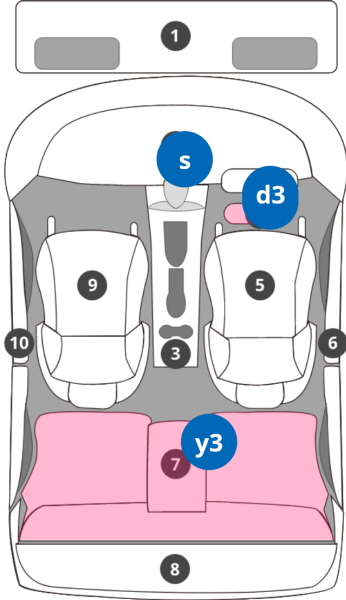
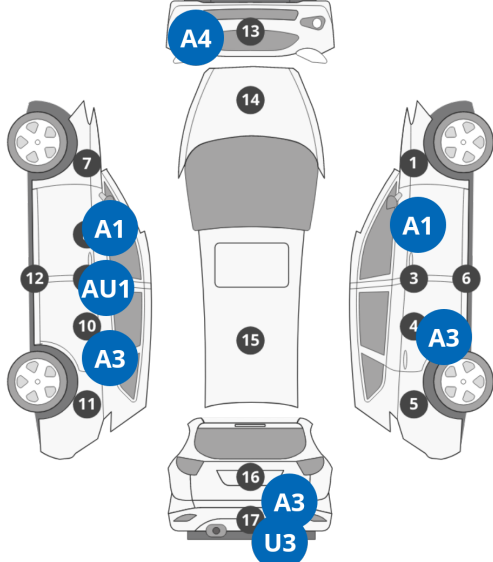
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	133.0	140	128	131
2	Boot Lid	223.0	213	222	234
3	Roof	129.2	118	122	137/140
4	Left Front Fender	130.3	127	137	127
5	Left Front Door	136.0	137	133	138
6	Center Panel Left				
7	Left Rear Door	135.6	145	131	131
8	Left Back Panel	130.0	132	128	130
9	Right Front Fender	131.0	134	137	122
10	Right Front Door	140.0	141	137	142
11	Center Panel Right				
12	Right Rear Door	127.6	118	130	135
13	Right Back Panel	125.0	130	117	128

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / (L) Front Floor Mat - Cut, Crack - Medium / (R) Front Floor Mat - Crinkle - Medium / Rear Seat - Grime - Medium	Remarks (L) Front Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Mirror - Scratch, Peeled - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Dent - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

swirl marks and hairline scratches/ adhesive marks on the front windshield/