

General Information

Date & Time: 30, Jun, 2025 18:45

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	112,960
Registration No.	NEO5648	Chassis No.	PA1B18F39M4144543
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



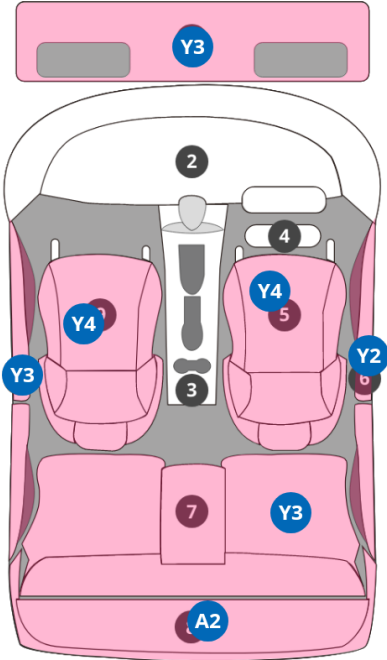
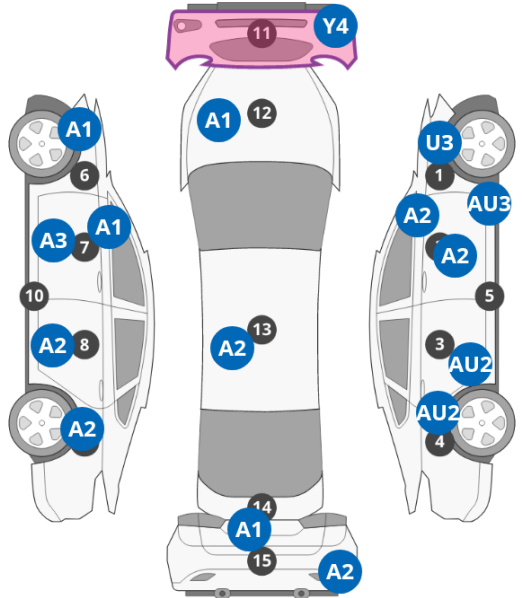
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.0	132	109	125
2	Boot Lid	124.3	127	115	131
3	Roof	108.0	113	100	103/116
4	Left Front Fender	105.0	104	101	110
5	Left Front Door	112.0	120	106	110
6	Center Panel Left				
7	Left Rear Door	112.6	118	115	105
8	Left Back Panel	114.3	118	114	111
9	Right Front Fender	103.3	100	105	105
10	Right Front Door	107.0	106	107	108
11	Center Panel Right				
12	Right Rear Door	109.3	101	114	113
13	Right Back Panel	112.6	113	108	117

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Large / Ceiling - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Small / Overall Interior - Worn as per age - Yes	Remarks (R) Front Fender, Molding - Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / Roof - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, no warranty booklet, with jack, incomplete tools, with spare tire