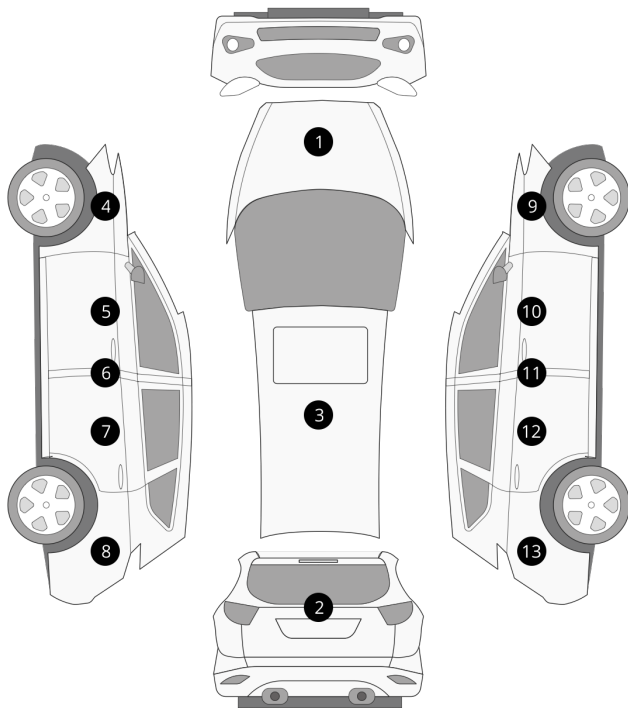


General Information

Date & Time: 01, Jul, 2025 13:03

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	66,576
Registration No.	NFQ6626	Chassis No.	PA1B18F36M4136903
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



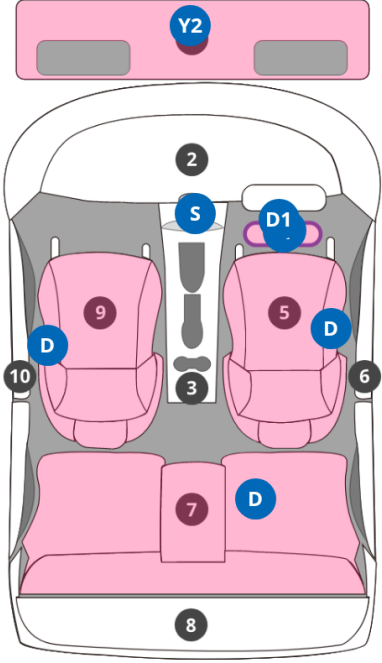
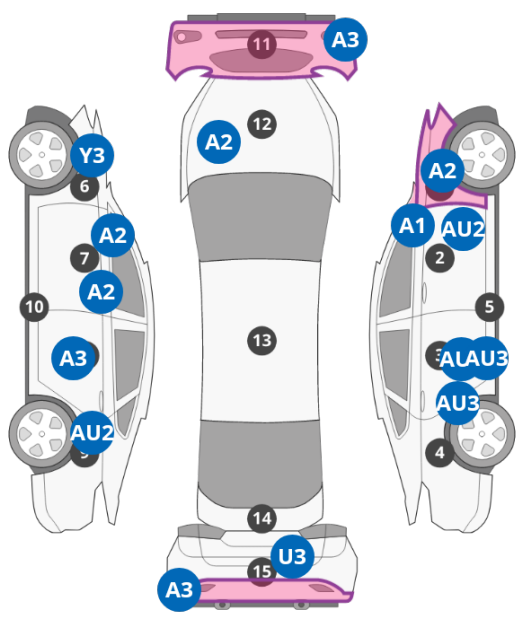
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	126.6	130	131	119
2	Boot Lid	201.0	222	169	212
3	Roof	116.7	121	109	116/121
4	Left Front Fender	192.0	158	247	171
5	Left Front Door	120.3	111	115	135
6	Center Panel Left				
7	Left Rear Door	113.6	112	111	118
8	Left Back Panel	123.6	124	115	132
9	Right Front Fender	116.6	126	109	115
10	Right Front Door	112.0	112	113	111
11	Center Panel Right				
12	Right Rear Door	118.0	114	119	121
13	Right Back Panel	119.0	117	116	124

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Worked - Large / Overall Interior - Worn as per age - Yes / (L) Front Seat - Worn - Yes / (L) Front Floor Mat - Missing - Yes / Overall Interior - Smell - Yes / Ceiling - Grime - Small / Carpet - Worked - Minimal / (R) Front Seat - Worn - Yes / Rear Seat - Worn - Yes	Remarks (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Dent - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Wheel, Cover - Cap Missing - Yes / (L) Front Fender, Molding - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal
Frame Evaluation : B	Functional Evaluation : B
Remarks Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, no jack, incomplete tools, with spare tire no rims, with LTO plate, scratches on tail light and headlight, cracked headlight, missing trunk floor mat, loose rear seat, adhesive marks on overall exterior, with dash cam wire no cam, loose head unit