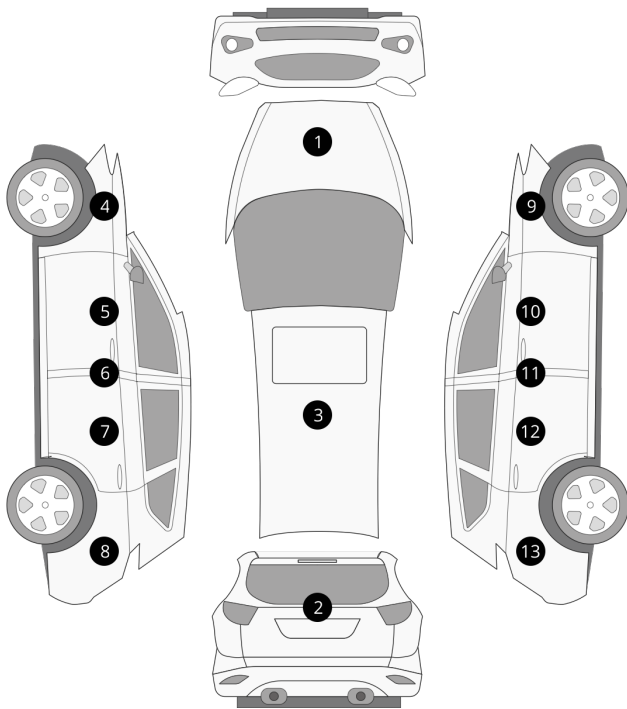


General Information

Date & Time: 30, Jun, 2025 17:13

Make	Toyota	Model	Wigo
YOM	2021	Odo Meter Reading	61,403
Registration No.	DAV2874	Chassis No.	MHKA4DF5MJ054773
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



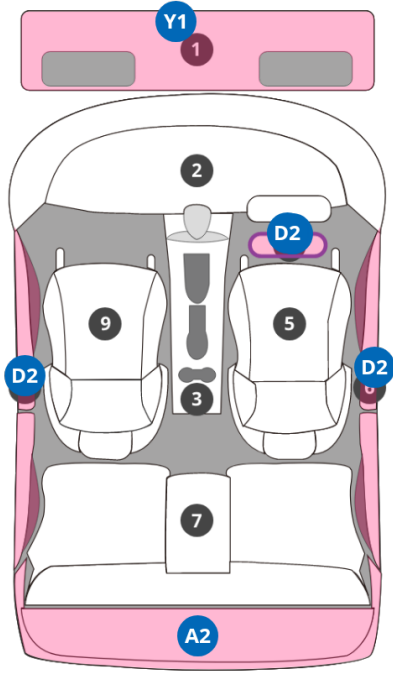
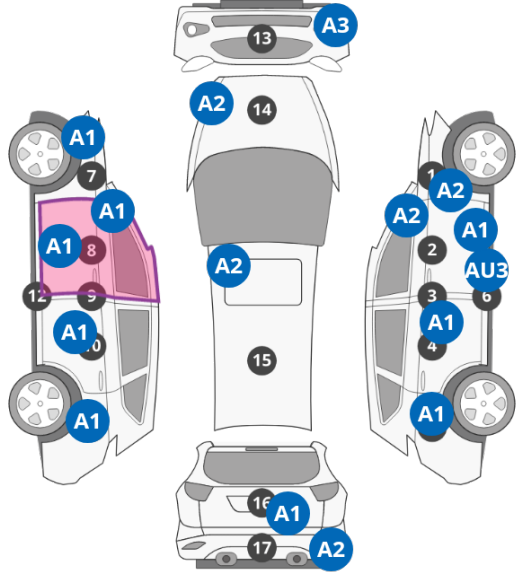
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.3	102	102	88
2	Boot Lid	106.3	104	112	103
3	Roof	93.2	82	99	98/94
4	Left Front Fender	142.3	134	142	151
5	Left Front Door	174.6	173	187	164
6	Center Panel Left				
7	Left Rear Door	99.9	100	103	97
8	Left Back Panel	100.5	102	93	107
9	Right Front Fender	105.0	104	101	110
10	Right Front Door	103.3	99	104	107
11	Center Panel Right				
12	Right Rear Door	103.5	109	102	100
13	Right Back Panel	102.6	104	97	107

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Missing - Yes / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Ceiling - Grime - Minimal	Remarks (L) Front Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Repair mark - Yes / (R) Mirror - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / Roof - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with warranty booklet, with jack, no tools, with spare tire, front right grab handle damaged