

General Information

Date & Time: 30, Jun, 2025 14:58

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	48,485
Registration No.	NHM6266	Chassis No.	PA1B18F39R4242057
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



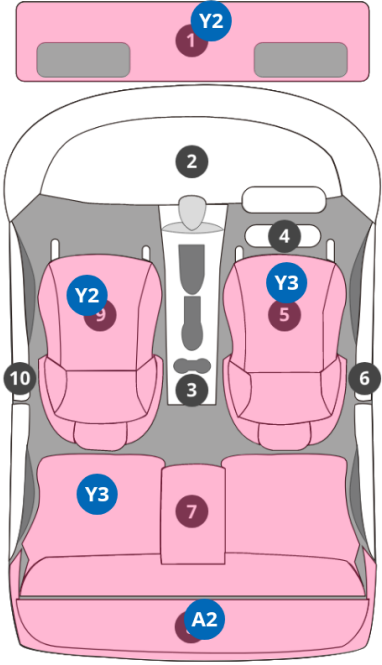
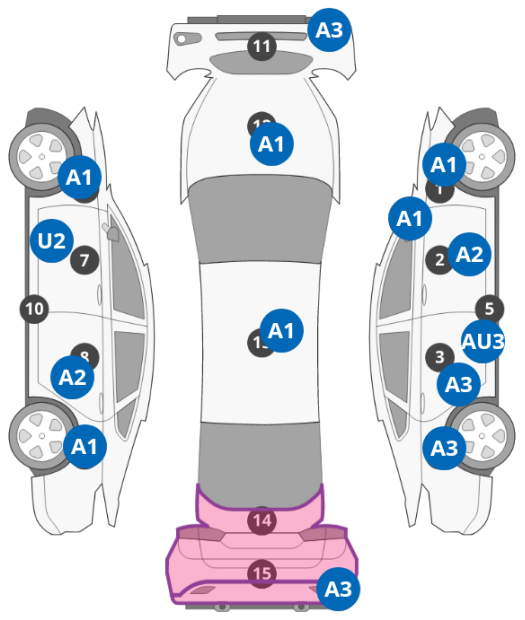
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	131.3	148	114	132
2	Boot Lid	238.0	261	199	254
3	Roof	116.7	128	113	110/116
4	Left Front Fender	111.3	106	110	118
5	Left Front Door	113.0	110	114	115
6	Center Panel Left				
7	Left Rear Door	119.3	129	116	113
8	Left Back Panel	118.0	122	120	112
9	Right Front Fender	119.3	125	117	116
10	Right Front Door	127.6	132	121	130
11	Center Panel Right				
12	Right Rear Door	132.3	123	128	146
13	Right Back Panel	127.6	128	128	127

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Medium / Ceiling - Grime - Small / (L) Front Seat - Grime - Small	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Dent - Small / (L) Rear Door, Molding - Scratch - Small / Roof - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
with LTO plate, no warranty booklet, with jack and tools, with spare tire, busted plate light, trunk latch issue, head unit issue