

General Information

Date & Time: 05, Nov, 2024 15:11

Make	Toyota	Model	Vios
YOM	2022	Mileage	9,584
Registration No.	DBB5376	Chassis No.	PA1B18F36N4191837
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



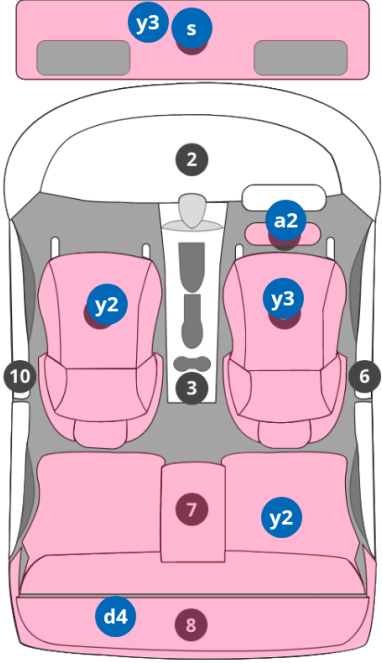
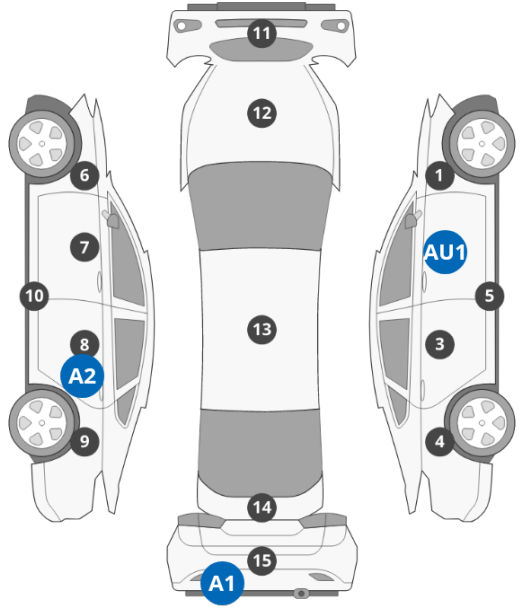
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	128.0	133	124	127
2	Boot Lid	125.3	119	124	133
3	Roof	115.2	123	107	118/113
4	Left Front Fender	113.3	113	117	110
5	Left Front Door	117.6	116	122	115
6	Center Panel Left				
7	Left Rear Door	117.0	117	117	117
8	Left Back Panel	119.3	126	117	115
9	Right Front Fender	114.6	114	116	114
10	Right Front Door	108.6	115	106	105
11	Center Panel Right				
12	Right Rear Door	113.3	110	110	120
13	Right Back Panel	113.0	108	110	121

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : A
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / (L) Front Floor Lag - Cut, Crack - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Medium / Trunk Room - Loose, Deformed, Grime - Large / Rear Seat - Grime - Small / (R) Front Seat - Grime - Medium	Remarks (R) Front Door, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
light scratches around the exterior.