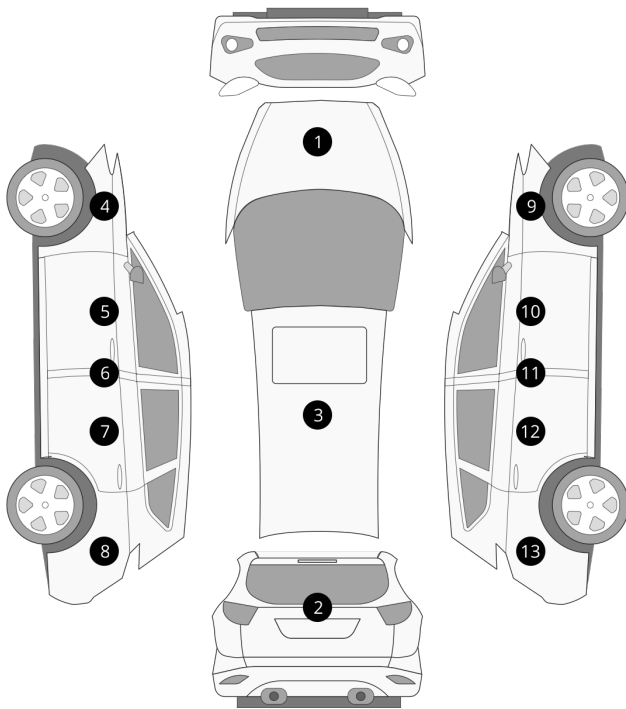


General Information

Date & Time: 01, Jul, 2025 12:41

Make	Toyota	Model	Wigo
YOM	2021	Odo Meter Reading	55,692
Registration No.	GAT5259	Chassis No.	MHKA4DF5FMJ053864
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



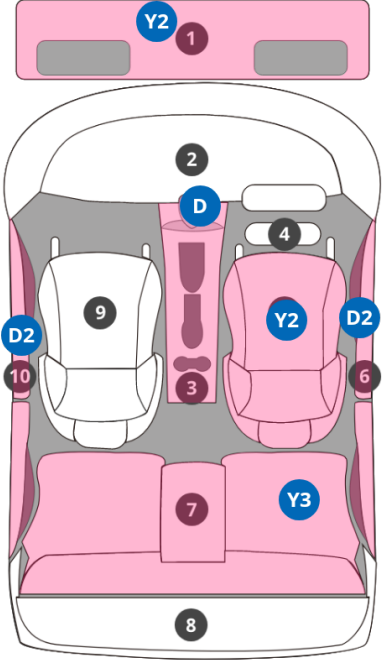
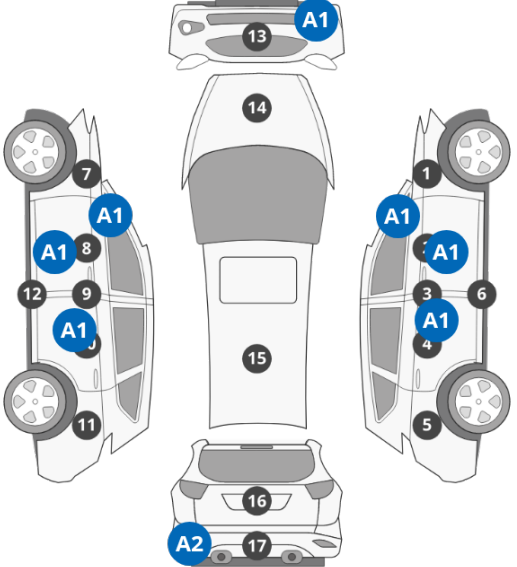
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	94.3	91	87	105
2	Boot Lid	113.3	116	113	111
3	Roof	99.8	87	106	107/100
4	Left Front Fender	139.3	159	136	123
5	Left Front Door	105.1	111	106	98
6	Center Panel Left				
7	Left Rear Door	101.1	99	100	104
8	Left Back Panel	95.1	93	98	94
9	Right Front Fender	142.6	126	163	139
10	Right Front Door	97.7	97	101	95
11	Center Panel Right				
12	Right Rear Door	98.3	98	100	97
13	Right Back Panel	107.0	108	113	100

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : A
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Small / (R) Front Trim - Worked - Small / (L) Front Trim - Worked - Small / Console, Switchs, Vents - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small / Overall Interior - Worn as per age - Yes	Remarks Bonnet - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes
no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light